Ontario Geological Survey
Miscellaneous Paper 112

Slope Stability Study of the South Nation River and Portions of the Ottawa River

by
A.S. Poschmann, K.E. Klassen,
M.A. Klugman, and D. Goodings

A project funded by the South Nation River Conservation Authority, the Federal Department of Regional Economic Expansion, and the Ontario Ministry of Natural Resources.

1983

Ontario
Ministry of Natural Resources

Hon. Alan W. Pope
Minister

W.T. Foster
Deputy Minister

South Nation River
Conservation Authority

©OMNR-OGS 1983
Printed in Canada

ISSN 0704-2752
ISBN 0-7743-8219-8

Publications of the Ontario Ministry of Natural Resources are available from the following sources. Orders for publications should be accompanied by cheque or money order payable to the *Treasurer of Ontario*.

Reports, maps, and price lists (personal shopping or mail order):
Public Service Centre, Ministry of Natural Resources
Room 1640, Whitney Block, Queen's Park
Toronto, Ontario M7A 1W3

Reports and accompanying maps (personal shopping):
Ontario Government Bookstore
Main Floor, 880 Bay Street
Toronto, Ontario

Reports and accompanying maps (mail order or telephone orders):
Publications Services Section, Ministry of Government Services
5th Floor, 880 Bay Street
Toronto, Ontario M7A 1N8
Telephone (local calls), 965-6015
Toll-free long distance, 1-800-268-7540
Toll-free from Area Code 807, 0-ZENITH-67200

This publication can also be obtained from:
Ontario Ministry of Natural Resources
Concession Road
Kemptville
Ontario K0G 1J0
Telephone 613 - 258-3413

This project was funded by the South Nation River Conservation Authority, the Federal Department of Regional Economic Expansion, and the Ontario Ministry of Natural Resources.

Every possible effort is made to ensure the accuracy of the information contained in this report, but the Ministry of Natural Resources does not assume any liability for errors that may occur. Source references are included in the report and users may wish to verify critical information.

Parts of this publication may be quoted if credit is given. It is recommended that reference to this report be made in the following form:

Poschmann, A.S., Klassen, K.E., Klugman, M.A., and Goodings, D.
1983: Slope Stability of the South Nation River and Portions of the Ottawa River; Ontario Geological Survey, Miscellaneous Paper 112, 20p. Accompanied by Geotechnical Series Maps 2486 and 2487, scale 1:50 000.

Critical Reader: O.L. White
Scientific Editor: Guy Kendrick

1000-83-Twin Offset

FOREWORD

SLOPE STABILITY STUDY OF THE SOUTH NATION RIVER AND PORTIONS OF THE OTTAWA RIVER

This report is the second report of its type to be published by the Ontario Geological Survey. Prepared by the staff of the Eastern Region Office of the Ministry of Natural Resources, the report draws attention to the existence of potentially unstable slopes along the valley of the South Nation River and its several tributary streams together with part of the Ottawa River. The clay soils forming these slopes owe their origin to material deposited in the waters of the Champlain Sea which covered the area during deglaciation about 13 000 years ago.

The objective of this report is not only to alert the general public, planners, and the municipalities to the potential hazards, but also to encourage developers and land owners to arrange for adequate geotechnical investigation of all land in the vicinity of river banks and slopes well in advance of any construction or development thereon.

E.G. Pye
Director
Ontario Geological Survey

CONTENTS

Introduction 1

Origin and Characteristics of the Champlain Sea Clays 2

History of Deposition 2

Characteristics of the Champlain Sea Clays 3

Slope Failure 3

Field Program 6

Airphotos 6

Slope Measurement 6

Analysis 6

Slope Classification 8

Slope Stability Classifications 9

Summary 10

Acknowledgments 10

Appendix 1 11

Computer Program 11

Appendix 2 12

Computed Factors of Safety for Surveyed Sites 12

References 19

TABLE

Table 1—Some values for 'Effective Angle of Internal Friction ϕ' ', 'Effective Cohesion c' ', and 'Pore Pressure r_u' obtained from site-specific studies in the Ottawa and South Nation River area 9

FIGURES

Figure 1—The Champlain Sea and location of the study area 2

Figure 2a—Sheet Slide 3

Figure 2b—Simple Rotational Failure 4

Figure 3a—Retrogressive Rotational Failure 4

Figure 3b—Retrogressive Flowslide 5

Figure 4—Earthflow 5

Figure 5—Showing the relationships between the slope inclinations, the slope heights, and the Factors of Safety as computed for this study 7

Figure 6—Failed and unfailed slopes related to height, inclination, and the Factors of Safety 1.0 and 1.5 8

GEOTECHNICAL SERIES MAPS

(back pocket)

Map 2486 (coloured)—Slope Stability Study of the South Nation River and Portions of the Ottawa River, Northern Sheet, Southern Ontario, scale 1:50 000.

Map 2487 (coloured)—Slope Stability Study of the South Nation River and Portions of the Ottawa River, Southern Sheet, Southern Ontario, scale 1:50 000.

Conversion Factors for Measurements in Ontario Geological Survey Publications

If the reader wishes to convert imperial units to SI (metric) units or SI units to imperial units the following multipliers should be used:

CONVERSION FROM SI TO IMPERIAL			CONVERSION FROM IMPERIAL TO SI		
SI Unit	*Multiplied by*	*Gives*	*Imperial Unit*	*Multiplied by*	*Gives*
			LENGTH		
1 mm	0.039 37	inches	1 inch	**25.4**	mm
1 cm	0.393 70	inches	1 inch	**2.54**	cm
1 m	3.280 84	feet	1 foot	**0.304 8**	m
1 m	0.049 709 7	chains	1 chain	20.116 8	m
1 km	0.621 371	miles (statute)	1 mile (statute)	**1.609 344**	km
			AREA		
1 cm^2	0.155 0	square inches	1 square inch	**6.451 6**	cm^2
1 m^2	10.763 9	square feet	1 square foot	**0.092 903 04**	m^2
1 km^2	0.386 10	square miles	1 square mile	2.589 988	km^2
1 ha	2.471 054	acres	1 acre	0.404 685 6	ha
			VOLUME		
1 cm^3	0.061 02	cubic inches	1 cubic inch	**16.387 064**	cm^3
1 m^3	35.314 7	cubic feet	1 cubic foot	0.028 316 85	m^3
1 m^3	1.308 0	cubic yards	1 cubic yard	0.764 555	m^3
			CAPACITY		
1 L	1.759 755	pints	1 pint	0.568 261	L
1 L	0.879 877	quarts	1 quart	1.136 522	L
1 L	0.219 969	gallons	1 gallon	**4.546 090**	L
			MASS		
1 g	0.035 273 96	ounces (avdp)	1 ounce (avdp)	28.349 523	g
1 g	0.032 150 75	ounces (troy)	1 ounce (troy)	**31.103 476 8**	g
1 kg	2.204 62	pounds (avdp)	1 pound (avdp)	**0.453 592 37**	kg
1 kg	0.001 102 3	tons (short)	1 ton (short)	**907.184 74**	kg
1 t	1.102 311	tons (short)	1 ton (short)	**0.907 184 74**	t
1 kg	0.000 984 21	tons (long)	1 ton (long)	**1016.046 908 8**	kg
1 t	0.984 206 5	tons (long)	1 ton (long)	**1.016 046 908 8**	t
			CONCENTRATION		
1 g/t	0.029 166 6	ounce (troy)/ ton (short)	1 ounce (troy)/ ton (short)	34.285 714 2	g/t
1 g/t	0.583 333 33	pennyweights/ ton (short)	1 pennyweight/ ton (short)	1.714 285 7	g/t

OTHER USEFUL CONVERSION FACTORS

1 ounce (troy)/ton (short)	20.0	pennyweights/ton (short)
1 pennyweight/ton (short)	0.05	ounce (troy)/ton (short)

NOTE—Conversion factors which are in bold type are exact. The conversion factors have been taken from or have been derived from factors given in the Metric Practice Guide for the Canadian Mining and Metallurgical Industries published by The Mining Association of Canada in cooperation with the Coal Association of Canada.

Slope Stability Study of the South Nation River and Portions of the Ottawa River

by

A.S. Poschmann[1], K.E. Klassen[2], M.A. Klugman[3], and D. Goodings[4]

INTRODUCTION

The South Nation River and the Ottawa River are two of the largest rivers in southern Ontario. The South Nation River drains an area of about 3700 km^2. The Ottawa River drains an area of about 145 000 km^2. The South Nation River descends 84 m over a distance of 177 km from its source to its junction with the Ottawa River (Chapman and Putnam 1966). Extensive deposits of glacially derived marine clays that were laid down in the Champlain Sea occur in the study area.

The tendency for river banks and slopes composed of Champlain Sea clays in southeastern Ontario to fail and cause large and small scale landslides, is causing an increasing amount of interest and concern. Costly damage to buildings and loss of life may result from construction on unstable clay slopes. Because of these problems the Ontario Ministry of Natural Resources is endeavoring to classify the clay slopes according to their stability in areas once covered by the Champlain Sea.

The classification of the slopes in this sensitive clay is intended to alert developers and planners to the need for determining the geotechnical evaluation of the stability of a slope at a specific site. Thus, unstable slopes can be identified and the necessary remedial or protective measure designed. These measures should be based upon the geotechnical investigations carried out prior to any development of a site. Property damage and inconvenience can then be reduced.

It must be stressed that this classification of the slopes is presented as a guideline, and not as a site specific value for engineering design.

The methods used in this report are a refinement of those developed in the report 'Slope Stability Study of the Regional Municipality of Ottawa-Carleton' (Klugman and Chung 1976) to classify slopes in these postglacial marine clays. The study involved locating and mapping different types of failures that occur in slopes in the Champlain Sea clays. The slope heights and inclinations were measured at points on the slopes considered to be representative of a section of slope. These survey data were used to calculate the 'Factor of Safety', which is a numerical representation of the stability of a slope. These Factors of Safety were used in the process of classifying the slopes. Each class identified offers guidelines for determining the amount of geotechnical investigation necessary to ensure the safe use of a site.

The slopes examined in this report are contained in the South Nation River watershed, and along the Ottawa River from Ottawa to Treadwell. Treadwell is located approximately 8 km east of the mouth of the South Nation River. Financial support was provided by the South Na-

[1]Geotechnical Engineer, Eastern Region, Ontario Ministry of Natural Resources, Kemptville
[2]Geotechnical Engineer, Eastern Region, Ontario Ministry of Natural Resources, Kemptville
[3]Regional Mines Coordinator, Eastern Region, Ontario Ministry of Natural Resources, Kemptville
[4]Field Assistant attached to Regional Mines Coordinator's Office, Eastern Region, Ontario Ministry of Natural Resources, Kemptville
Approved for publication by the Chief, Engineering and Terrain Geology Section, Ontario Geological Survey, Toronto, 6 April 1983
This report is published by the permission of E.G. Pye, Director, Ontario Geological Survey, Toronto

tion River Conservation Authority, the Ontario Ministry of Natural Resources, and the Federal Department of Economic Expansion under the Eastern Ontario Subsidiary Agreement.

ORIGIN AND CHARACTERISTICS OF THE CHAMPLAIN SEA CLAYS

HISTORY OF DEPOSITION

The sensitive clays of southeastern Ontario, which are commonly known as the Champlain Sea, or Leda clays, were deposited during the late stages of the Wisconsinan glaciation. At that time, the retreat of the Laurentide ice sheet enabled the Champlain Sea to invade the St. Lawrence Lowlands and Ottawa Valley, and much of southeastern Ontario.

The Champlain Sea began to transgress across southeastern Ontario sometime before 12 800 B.P. At that time, the land surface was inundated as far as Clayton, Ontario (Gadd 1978a, 1978b). The sea continued migrating westward to reach a limit which extends from west of Pembroke, to west of Smiths Falls, then south to Brockville on the St. Lawrence River (Figure 1). Much of the land surface was submerged to depths up to 190 m. Isostatic rebound then began to progress more quickly than the general worldwide rise in sea level which occurred at the end of the glacial period (Kenney 1964). The influx of fresh water from Lake Ojibway-Barlow progressively decreased the salinity of the regressing sea. By 10 200 B.P., the Champlain Sea was sufficiently drained from southeastern Ontario for a fluvial regime at Bourget, Ontario to become established (Gadd 1978a, 1978b).

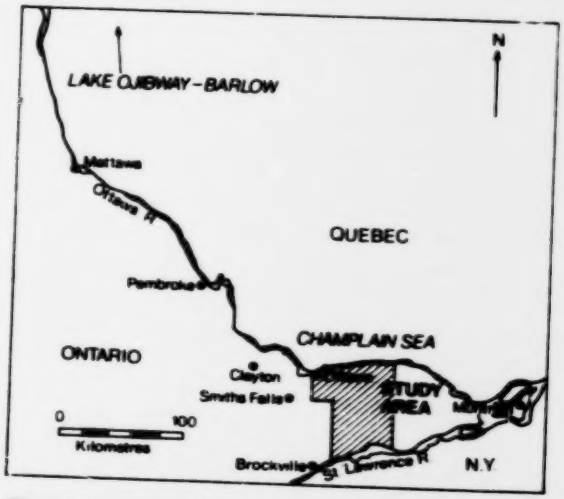

***Figure 1**—Diagram to show Champlain Sea, Lake Ojibway-Barlow, and location of study area.*

The surficial geology of the area under study in this report was included in the regional study of Chapman and Putnam (1966) and, in more detail, in maps prepared by Gwyn and Lohse (1973), Gwyn and Thibault (1975), Sharpe (1979), and Richard (1982a, 1982b, 1982c, and 1982d).

The Champlain Sea clays are highly variable in texture and composition because of changes in environment during the transgression and regression of the sea, and the subsequent fluvial reworking of the clays.

Underlying much of the study area, is a thin deposit of rhythmically stratified silt and silty clay, which is in contact with glacial features left by the retreating ice sheet. Fransham and Gadd (1977) proposed that this varved sequence represents material deposited in the transgressing sea in close proximity to the glacier. The conditions under which deposition occurred would thus be controlled by the large volume of melt water coming from the ice sheet; and the process of rhythmic deposition would not be impeded.

The influx of fresh water diminished with the retreat of the glacier. The clays deposited under the increasingly saline conditions show a gradation from clearly varved fresh water to massive marine clays (Fransham and Gadd 1977; Gadd 1978a, 1978b).

The marine clays deposited in a deep sea environment are typically dark grey, but light layering or black sulphurous mottled clay do sometimes occur.

A continuing uplift of the land surface resulted in the placement of shallow, pro-delta deposits over the top of the massive clays. These materials are usually layered, red and grey, or light and dark grey, and contain seams of silt. Beds with a high clay content are darker red or grey than the more clay deficient layers. Material deposited in more shallow and less saline waters contain more pronounced silt and silty clay layers than material deposited in a deep sea environment.

Sequences deposited in the regressing Champlain Sea contain reworked clay-sized material from areas that had been uplifted and subjected to erosion. It is this clay to which the red tint of the beds is attributed (Johnston 1917). The red colour is particularly evident in the material deposited in the estuarine environment of the ancestral Ottawa River. Inflow from Lake Ojibway-Barlow provided a large volume of fresh water. This water eroded the clay deposits to the northwest and reworked and deposited the material further to the east.

A 2 to 4 m thickness of sand overlies the Champlain Sea clays. This fine-grained sand, believed to have been deposited by fluvial activity after the withdrawal of the sea, now covers large areas of southeastern Ontario. In some locations, the contact between the clay and the sand is gradational.

The thickness of the Champlain Sea deposits varies greatly, and is dependent on the bedrock topography and the amount of erosion subsequent to deposition. At the western limit of the Champlain Sea, shoreline features were not well developed or if they did develop, have been eroded away. In the natural depressions in the bedrock, considerable thicknesses of Champlain Sea clays still occur. Near Arnprior, 91.5 m of clay can be found at the site of a gravity clay fill dam (Wong *et al.* 1975) at Waba. Much further east at Treadwell, a depth of 104.7 m was measured (Fransham, Gadd, and Carr 1976a, 1976b).

CHARACTERISTICS OF THE CHAMPLAIN SEA CLAYS

The term clay, when used with reference to the Champlain Sea clay, applies only to the particle size of the sediment and not to the composition. Even this usage of the word 'clay' can be a misnomer because the Champlain Sea deposits are highly variable. The more massive deposits have a clay size fraction as high as 80%, while the layered material in the shallower deposits can have as little as 30% clay. Silt and sand horizons are quite common.

The clay-sized fraction of the Champlain Sea clays is composed of rock flour. Rock flour is rock material ground to a fine consistency by glacial action. In the Champlain Sea clays, the rock flour is composed predominantly of feldspar, quartz, and amphibole with minor amounts of clay minerals, these are usually illite, chlorite, and vermiculite. The percentage of the constituent minerals is highly variable, though quartz generally dominates.

The Champlain Sea clays are stratified deposits with differences in physical properties both laterally and vertically because of changes in the environment of deposition. Extensive studies of the properties of the clay have been carried out at site-specific localities. These localities have been at the sites of particularly noteworthy landslides, or at the sites of large bridges and dams. No regional studies of the relative geotechnical properties of the clays have yet been undertaken in Ontario.

The most important property common to the clays at all these locations has been the 'sensitivity' of the material. Sensitivity is the ratio of the undisturbed strength of the soil to the remoulded (disturbed) strength. The natural strength, which is lost when the soil is disturbed, is due to bonding and orientation of the clay particles.

The bonding in the clays is not fully understood; however, several theories have been proposed. One theory, which appears to have wide support, is that the clay in its natural state, has particles cemented together in an open flocculated structure, rather like a house of cards. The strength of the clay in this state depends on the cementing and the degree of openness in the structure. If the clay material is disturbed or remoulded, the flocculated structure breaks, the particles realign, and the strength decreases. Weak or strong clays may have high or low sensitivities.

The Champlain Sea clays from various locations exhibit high liquidity indices. This index gives an indication of the flocculated nature of the material. High silt content will lower the index and modify the structure in the deposit.

SLOPE FAILURE

Slope failure in Champlain Sea clays produces easily recognizable landforms that can be seen clearly on aerial photographs. The stability of all slopes is dependent on the geometry of the slope, the physical properties of the material composing the slope, and the pore water pressures existing within the material. Thus, slopes with a similar geometry can vary in stability. This is due to differences in stratigraphy, structure, and the season of the year. Seasonally, variations occur because of the differences in the amount of precipitation and the fluctuating water table.

Failure in the clays can take one of several forms. A common failure type is the simple rotational slip of a segment of slope. The curvature of the slip surface can vary greatly.

When the failure arc can be drawn as a portion of a circle with an almost infinite radius, the failure is called a sheet slide (Figure 2a). When the curvature is more pronounced, it is known as a simple rotational slip (Figure 2b).

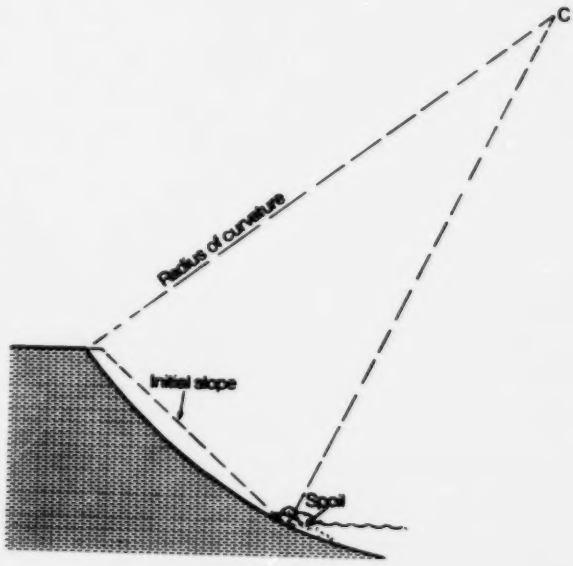

***Figure 2a**—Cross section of a sheet slide.*

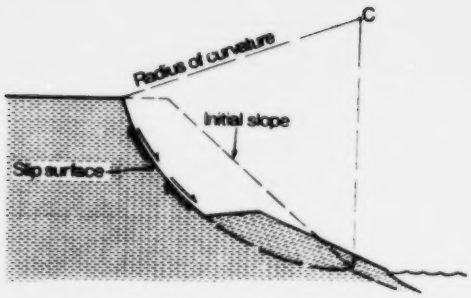

***Figure 2b**—Cross section of a simple rotational shear.*

Often one small rotational slip will initiate failure of successive segments of slope which can continue through numerous slides to form a reverse-sloped, terracing effect in the slope (Figure 3a). This type of failure is termed a retrogressive rotational slide.

A variation of the same kind of failure is the retrogressive flowslide. The slope segments in the retrogressive rotational failure slip a short distance along the failure arc, and the slope segments in a retrogressive flowslide exhibit extreme rotation. In large retrogressive flowslides, it is possible to see intact clay pinnacles rising from the debris. These pinnacles form as a result of the rotation of the failed slope segments, and are composed of intact clay (Figure 3b).

If a failure in a slope develops and retrogresses through the upland without the rotational sliding associated with a retrogressive rotational failure or a retrogressive flowslide, that failure is called an earthflow. Earthflows are believed to be initiated by the failure of a small segment of slope which normally has a remoulded effect on the clay in the slope. The remoulded material will flow, cause more of the slope to fail, and activate more clay (Figure 4). Clay pinnacles can often be seen in the debris of earthflows, but they are composed of remoulded clay squeezed between blocks of intact material.

Earthflows terminate when the character of the uplands material changes, or when a balance is achieved between the spoil material and the backslope, or when the outlet becomes constricted.

When an earthflow is held in check because of the build-up of materials at its outlet, neither the slope nor the spoil can be considered stable. Removal of material from the outlet may start afresh the flow of spoil. In 1977, the South Nation River was blocked when spoil from a slide that had occurred in 1971 moved again. The river had, over the 6-year period, eroded material from the outlet and allowed the spoil to shift. This reblocked the outlet. As erosion continues, it is likely that the process will repeat itself. Earthflows and retrogressive flowslides leave thumbprints on the land surface that last for thousands of years.

Two other types of failure commonly occur. One type is the erosional slumping that occurs at the toe of slopes due to erosion caused by the flow of water in the adjacent river or stream. Such failures tend to be small because the erosional effect of the water action is concentrated in the limited area of the immediate river bank. These slopes are short and steep, often with overhanging vegetation.

The second failure type occurs not in the clay itself, but in the fine sand and silt that overlies the clay in many areas. This kind of failure has been referred to by Mitchell and Klugman (1979) as internal erosion. Like the earthflow, it is a rapid mass wasting process without a rotational slip. What remains is a gully with near vertical sides and a low gradient. Little spoil is left in this resulting gully, or creek bed, because the water content in the failed material is such that the silt and sand flow as a slurry.

Instability in clay slopes is most often initiated by changes in the geometry of the slope profile. Erosional activity by nature or disturbance by man can oversteepen a slope, causing instability. Even though the geometry of

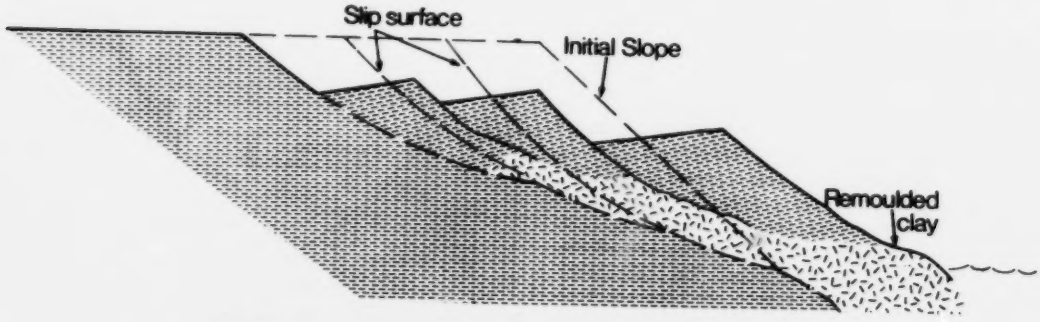

***Figure 3a**— Cross section of a retrogressive rotational shear.*

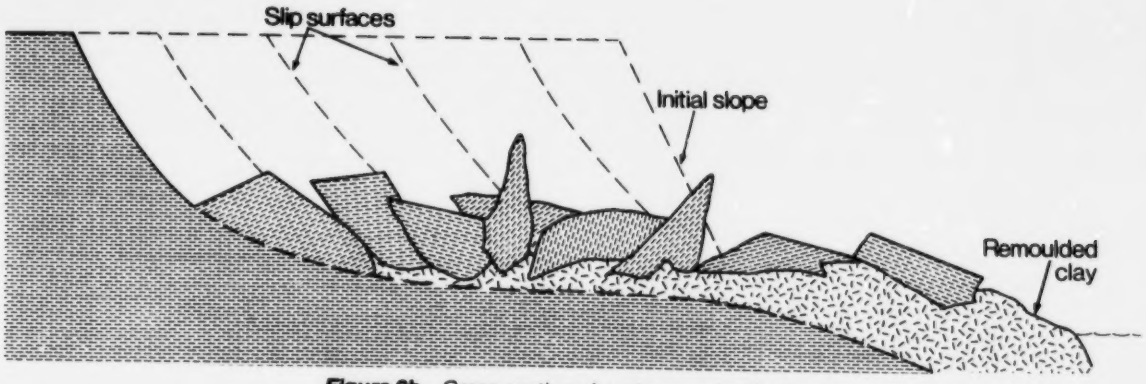

***Figure 3b**—Cross section of a retrogressive flowslide.*

the slope may be unstable, actual slope failure may not occur until the pore water pressures and other conditions or processes are conducive to failure.

Many slope failures have occurred in the area of the South Nation River watershed. These are usually small landslides or failures, measuring from a few thousand cubic metres of material up to many hectares. Old scars indicate that many larger failures, 25 ha or more, have occurred in this basin. The most recent of these large slides occurred in 1971, 2.5 km upstream from the village of Lemieux on the South Nation River, when 36 ha of pastureland failed.

Both large and small failures, which occur every year, can cause considerable local distress. The principle concerns of this study are to delineate the areas of potential failure, and to record past failures. The responsible authorities should ensure that any area slated for development has been properly assessed for safety against possible slope failures or landslides.

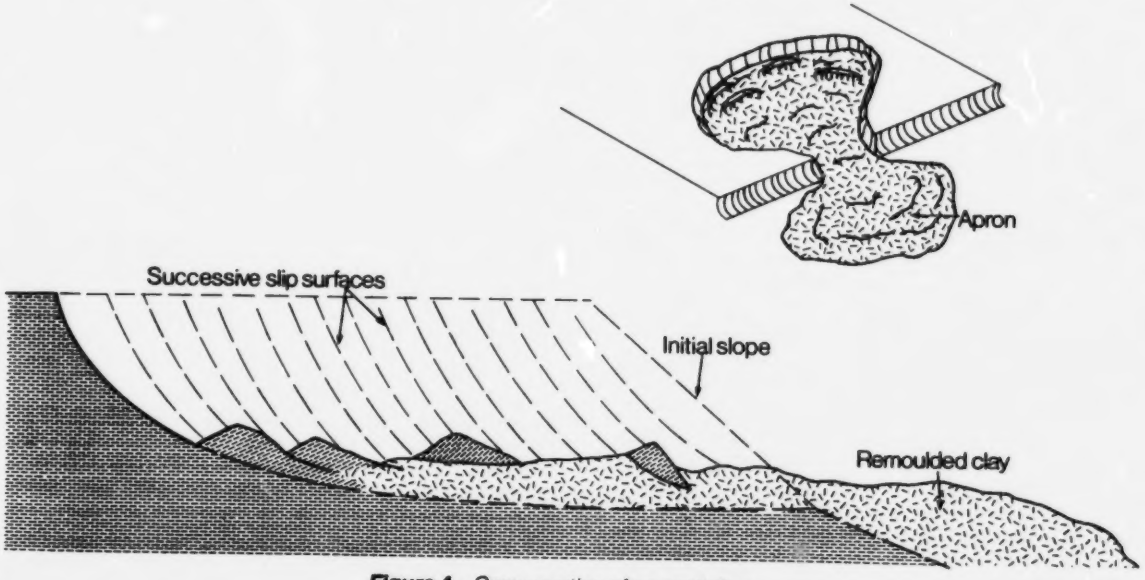

***Figure 4**—Cross section of an earth flow.*

FIELD PROGRAM

The field program was started in 1976 and completed in 1980. All creeks and river banks in the South Nation River basin were examined. Slope failures and landslide scars were recorded where recognized. Large slope failures previously mapped by the Geological Survey of Canada were, after field checking, incorporated into the maps of this present report (Fransham *et al.* 1976a, 1976b).

The field work was carried out by canoe on the South Nation, Castor, and Ottawa Rivers. This allowed easy access to the river banks. Where the volume of water was insufficient for canoeing, as was the case on its tributaries, the examination of the slopes was carried out on foot. The locations of the survey points and slide scars were accurately located on airphoto overlays during the examination of each site.

AIRPHOTOS

The airphotos used in the field were 1971 photographs at a scale of 1:17 000. This scale proved large enough for efficient and accurate plotting of locations. All river banks were examined in stereo pairs prior to entering the field. The method of interpretation has been described in the thesis, "Air Photo Classification and Glossary of Landslide Problems in the Ottawa and St. Lawrence Lowlands" (Poschmann 1978). Pertinent features and areas of possible interest were noted on the overlays that were attached to alternate photographs. In the field, the overlays were used to record the locations of the slope survey sites along with the data collected in the field, as well as other features such as landslide scars. These data were then transposed from the overlays to NTS topographic maps at a scale of 1:50 000. The survey points were numbered and the different failure types appropriately indicated in the following categories; earthflows, retrogressive flowslides and retrogressive rotational slides, rotational slides, sheetslides, failing slopes, and internal erosion features.

SLOPE MEASUREMENT

In order to determine the stability of a particular slope, it is necessary to obtain information on its profile. This was done in the field using a metre stick and clinometer.

The profile of a portion of a river bank was measured at a point in that segment considered to be representative of the whole. This point is referred to as a survey point. At each survey point, the height of the bank was measured by traversing the slope with a metre stick, and the inclination was taken with a clinometer held parallel to the slope. These measurements illustrate the slope profile only on the day the survey was taken. Hence, they are time dependent. In addition, because the information is used to represent conditions on a length of the slope, the computed data cannot be considered to be site specific.

Slopes with profiles that showed variations in inclination with height were measured in segments to better delineate the true slope. Survey points were taken wherever there was a change in the height or inclination of the slope. Profiles of the failed surfaces of all types of landslides were surveyed, along with the profile of the adjacent slope. The adjacent slope profile serves to illustrate the probable slope conditions prior to the failure and is used to classify the slope in that sector.

Measurements were particularly important on slopes >2 m in height or with a grade greater than 1:4. The maximum error in height was 1 m in slopes of 10 m or more, and due to the irregularities in the surfaces, the maximum error in the angle of inclination was 2°.

Special note was taken of bedrock when it was present in slopes, and also of existing flood plains. Their presence requires consideration in slope classification as both considerably affect the stability of the slope.

ANALYSIS

The stability classifications for slopes in Champlain Sea clays are based on the Factors of Safety calculated for each slope. The Factor of Safety is simply a number relating the magnitude of the forces holding a slope together to the magnitude of the forces that are seeking to level it. Theoretically, a Factor of Safety greater than 1.0 indicates that a slope is held together by forces larger than those seeking to fail it and the slope is stable. Conversely, if the Factor of Safety is less than 1.0, the slope is unstable, and the forces seeking to fail the slope are larger than the forces resisting them, and failure occurs.

A Factor of Safety equal to 1.0 is the critical condition in the ideal case where the soil characteristics and strength parameters, and the height, inclination, and saturation of the slope are accurately known. Given the conditions, it is possible to construct a graph, shown in Figure 5, illustrating the relationship between slope height, inclination, and the Factor of Safety.

Nevertheless, it has been found in these clays, that a factor of 1.5 rather than 1.0, is the critical Factor of Safety that must be used. This is well demonstrated in Figure 6, which is a plot of the failed and unfailed slopes related to height, inclination, and the Factors of Safety 1.0 and 1.5. An examination of the graph shows there are some slopes that have failed with Factors of Safety greater than 1.5. They represent only 6% of the surveyed slopes, and are due to factors as yet unidentified.

To calculate the Factor of Safety, the geometry of the slope, the groundwater conditions, and the strength of the soil need to be known. The slope profile and groundwater conditions, r_u (pore water pressure) are measured in the field. The strength parameters ϕ' (effective angle of internal friction) and c' (effective cohesion) are determined by laboratory testing.

The field program for this study involved measurement of the slope profiles only. Values for r_u, ϕ', and c' have been assumed. These assumed values are based

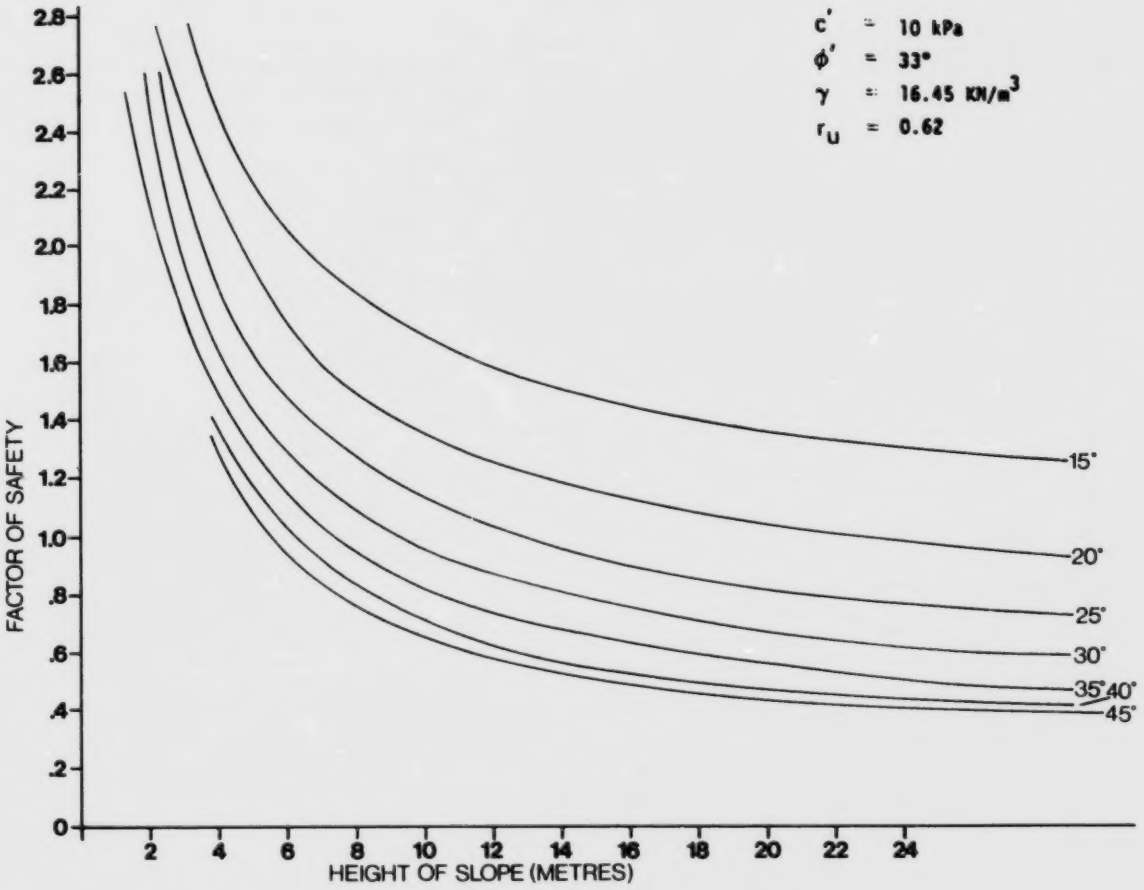

Figure 5—*Diagram showing the relationships between the slope inclinations, the slope heights, and the Factors of Safety as computed for a study in the Ottawa area (Klugman and Chung 1976).*

principally on publications by personnel of the National Research Council and their associated workers, from soils reports of the Ontario Ministry of Transportation and Communications, from consultant's reports throughout the area, from University theses, and limited testing by D.J. Goodings as a preliminary correlation with published data.

Slopes were assumed to be hydrostatically saturated. That is a situation where the top of the groundwater table coincides with the land surface and there is no motion in the fluid. This is a typical condition in the spring when most landslides occur. The parameters c' and φ' were assigned the values 10 kN/m² and 33° respectively. Table 1 shows that these values are realistic for use in the calculations used to categorize the clay slopes in the semi-quantitative classifications used in this report.

As a precaution against over-simplication, a range of Safety Factors for each condition was also calculated for φ' values of 30° and 35° by Klugman and Chung (1976). Their study found that these 2 conditions did not significantly affect the segments of the classification.

Two conditions are noted here in the analysis. The first condition occurs when bedrock is encountered at the foot of a slope. When bedrock was found, it was followed up into the bank as far as possible. Bedrock can act in a slope in 1 of 2 ways:

1. by forming an impermeable layer, which will keep the watertable high in a clay slope and increase the chances of failure by helping to saturate that slope and by acting as a slip surface for the clay to fail along, or
2. by composing most of the slope and reinforcing the thin clay mantle on top

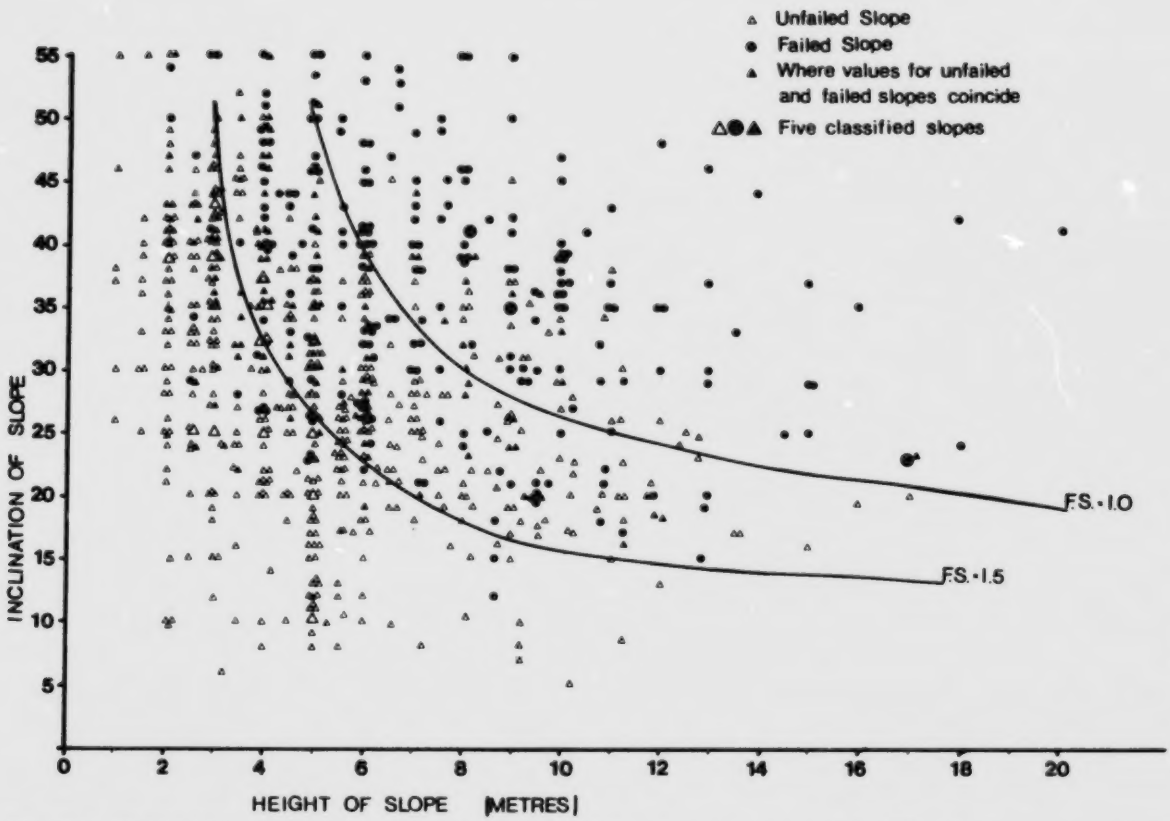

Figure 6—*Diagram showing the relationships of failed and unfailed slopes in the study area to height, inclination, and the Factors of Safety of 1.0 and 1.5.*

All calculations on such slopes were conservative, assuming from the last point of outcrop that the remaining part of the slope was not defended by bedrock. Slopes totally composed of rock are noted as such on the maps.

The second condition concerns the existence of 2 slopes, the river bank and an upper slope, separated by a terrace or floodplain. When the river bank was low, and an examination of the airphotos revealed that the floodplain was inundated during spring runoff, the upper slope was measured and a Factor of Safety established. In this case, the upper slope represents the worst slope conditions, saturated but not submerged. When the river banks are high, and the terrace is not flooded every spring, both slopes were measured and the lowest Factor of Safety was used to classify the slope.

SLOPE CLASSIFICATION

The slopes have been grouped into 6 classes based on the computed Factors of Safety. The specific values used in the classification are presented only as a guide to slope conditions, not as a firm basis for engineering design or development. Under all circumstances, site-specific studies and/or inspections should be carried out at all sites before any planning or development is undertaken.

A dual classification is given for each of the 6 classes of slope. One is a numerical value based on the calculated Factors of Safety, and the second is a parallel corresponding verbal description for each class. It is stressed that the classification system is generalized. This

TABLE 1 **SOME VALUES FOR 'EFFECTIVE ANGLE OF INTERNAL FRICTION ϕ' ', 'EFFECTIVE COHESION c' ' AND 'PORE PRESSURE r_u' OBTAINED FROM SITE-SPECIFIC STUDIES IN THE OTTAWA AND SOUTH NATION RIVER AREA.**

	Critical Strength Parameters				
Slope	**c' (kN/m²)**	**ϕ' (deg)**	**r_u**	**Remarks**	**Source**
Lemieux	8.2	39°	0.62	Assumed hydrostatic saturation.	Fondex Ltd. 1974.
South Nation Slide	9.0	36°	0.60	Assumed hydrostatic saturation.	Eden, Fletcher, Mitchell 1971.
Cumberland	12.4	25°	0.62	Assumed hydrostatic saturation.	Ontario Ministry of Transportation & Communications 1973.
Bearbrook	8.9	27°	0.62	Assumed hydrostatic saturation.	Golder Assoc. 1974.
Queenswood	11.1	33°	0.62	Assumed hydrostatic saturation.	Golder Assoc. 1974.
Castor River	11.4	34°	0.62	Assumed hydrostatic saturation.	D. Goodings 1976.
Bearbrook	7.3	34°	0.62	Assumed hydrostatic saturation.	D. Goodings 1976.
St. Bernadin Slide (in slide)	3.6	34°	0.62	Assumed hydrostatic saturation.	D. Goodings 1976.

has been done to take into account the fact that c' and ϕ' are averaged values and not entirely accurate numerical representations of strength at a specific location.

SLOPE STABILITY CLASSIFICATIONS (after Klugman and Chung 1976)

Factor of Safety — Guidelines

<0.8 Unsuitable for construction, or will require extreme remedial measures in order to safely utilize the site. These measures would need to be based upon extensive detailed geotechnical studies. The proportion of necessary investment to make the property usable for construction probably would out-weigh the cost of the completed structures. It is therefore not economically feasible.

0.8-1.2 Will require extensive remedial measures as dictated by detailed geotechnical studies. The necessary investment to prepare and stabilize the site will be great and probably would make normal development uneconomical.

1.2-1.5 Detailed geotechnical investigation necessary, with concomitant remedial works. This class, under undisturbed conditions, is considered marginal. Stabilization works or restrictive physical conditions would be necessary. Their type and extent would depend on the type of development.

1.5-2.0 Routine geotechnical investigation necessary. Developer would have to know soil conditions. Stabilization works would depend on type and size of planned structures.

2.0-2.5 Routine inspection necessary to determine the need and extent of geotechnical investigation.

>2.5 Should be inspected, but no remedial action likely to be required. This class also includes slopes that were inspected, but because of their nature, no detailed recordings were deemed necessary.

SUMMARY

As indicated on the northern and southern map sheets, the South Nation River and the portion of the Ottawa River that was studied illustrate variable slope characteristics. Areas with high Factor of Safety values can be directly adjacent to locations with lower Factors of Safety. Different Factors of Safety also occur on opposite banks of the river.

The portion of the South Nation River between Bear Brook and the Castor River is exceptionally prone to landsliding. Examples of areas with low Factors of Safety can be found around Fournier, St-Bernadin, and a section along the Ottawa River northwest of Orleans. Areas with high Factor of Safety values are found in the vicinity of Winchester and Spencerville. In general, rivers and streams south of Chesterville have higher Factors of Safety than the water courses in the northern part of the South Nation River watershed. It should be stressed that there are exceptions in each case.

ACKNOWLEDGMENTS

The writers would like to acknowledge the assistance and invaluable advice during the course of this study and the preparation of the manuscript of the following: staff members of the South Nation Conservation Authority; Professor R.J. Mitchell, Queen's University; Dr. N.R. Gadd, Geological Survey of Canada; and associates in the Ontario Ministry of Natural Resources and the Ontario Ministry of Transportation and Communications.

APPENDIX 1

COMPUTER PROGRAM

The computer program used for calculating the factors of safety was developed at the National Research Council by J. G. Arseneault (1967), and was adapted for the first report (Klugman and Chung 1976) by Professor R. J. Mitchell of Queen's University, Kingston, Ontario. The program solves for Factors of Safety by an iterative process using the Standard Bishop's equation for analysing slopes.

Each slope was approximated with three or more line segments resolved into a co-ordinate system. The toe of the slope was chosen as the point through which all slip circles in the failing slope would pass. The Factor of Safety was calculated by dividing each slip circle into 100 equal width slices through the slope over which the forces are calculated. One hundred such circles, each with a centre point located inside a designated search area, are solved to find the minimum factor of safety and the critical centre.

The slopes were assumed homogeneous in soil and ground water conditions. Given input data used were:

- c' —effective cohesion in kN/m^2 = $10kN/m^2$
- $\emptyset'$ —effective angle of internal friction in degrees = 33°
- γ —unit weight of soil in kN/m^3 = 16.45 kN/m^3
- r_u —pore pressure ratio = 0.62

The input data cards were arranged as follows:

Card 1 — 04	—slope number
Card 2 — 03	—number of line segments of slope (N)
Card 3 — x y	—co-ordinates of nodes of line
Card 4 — x y	—segments in consecutive order
Card 5 — x y	—(to a maximum of 20)
Card 6 — x y	
Card 7 — 1.00	—10-FS and c'
Card 8 — 10	—constant, other than 10 means variable
Card 9 — 16.45	
Card 10 — 10	—for constant r_u
Card 11 — 0.62	—r_u
Card 12 — 33	—$\emptyset'$ (in degrees)
Card 13 — 27 30	—other trial values of $\emptyset'$ for minimum F.S.
Card 14 — $X_s S_f$	—X co-ordinates for search area for critical centres.
Card 15 — $Y_s Y_f$	—Y co-ordinates for search area for critical centres.
Card 16 — X Y	—X, Y co-ordinates of chosen failure point.
Card 17 — Blank	—terminates readings and directs program to next slope number

On the basis of the given input data, it is possible to show the relationship between slope inclinations and slope heights to the calculated Factor of Safety. The plot shown in Figure 5, can offer an approximate guide for determining the Factor of Safety of simple slopes in the South Nation River watershed.

Each site surveyed in the South Nation River watershed is shown on the accompanying maps. The sites have been assigned a symbol and a site number. Symbols without numbers are locations of slope failures only. In places, it was not possible to take readings at these failures or alternatively, at the discretion of the senior author, measurements were deemed unnecessary.

Appendix 2 gives the computed Factors of Safety for all the surveyed sites. It must be stressed that the computed Factors of Safety are based on a profile measured at a point on the slope and illustrate the slope conditions only at the time it was surveyed. The Factors of Safety are time dependent values that should not be used for detailed site design. The Factors of Safety are presented solely as a guide to further work.

APPENDIX 2

COMPUTED FACTORS OF SAFETY FOR SURVEYED SITES IN THE AREA OF THE SOUTH NATION RIVER WATERSHED AND THE OTTAWA RIVER, FROM TREADWELL TO OTTAWA.

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
1	>2.50	36	2.50	71	2.20	106	1.39	141	1.10
2	1.82	37	1.45	72	1.60	107	1.38	142	0.96
3	1.69	38	1.58	73	1.57	108	1.52	143	1.25
4	1.36	39	2.50	74	1.31	109	1.45	144	1.50
5	1.40	40	1.23	75	0.94	110	1.80	145	0.77
6	1.48	41	2.40	76	1.33	111	1.35	146	1.05
7	1.52	42	1.22	77	0.98	112	1.64	147	0.97
8	1.68	43	1.54	78	1.33	113	1.29	148	1.05
9	2.00	44	1.87	79	1.55	114	1.38	149	0.97
10	1.31	45	0.78	80	1.58	115	1.15	150	1.22
11	1.04	46	>2.50	81	1.25	116	1.60	151	1.22
12	0.80	47	2.40	82	1.54	117	1.36	152	0.96
13	1.00	48	1.87	83	1.25	118	1.20	153	1.31
14	Bedrock	49	1.42	84	1.62	119	1.92	154	1.06
15	1.50	50	1.29	85	1.85	120	1.71	155	1.59
16	2.30	51	1.66	86	1.98	121	1.53	156	0.96
17	0.84	52	1.43	87	1.40	122	1.39	157	1.50
18	2.20	53	1.78	88	1.43	123	1.35	158	1.92
19	>2.50	54	1.42	89	1.42	124	1.35	159	1.43
20	>2.50	55	1.39	90	1.74	125	1.60	160	1.45
21	1.20	56	1.39	91	1.42	126	1.67	161	1.30
22	1.40	57	1.39	92	1.24	127	2.04	162	1.65
23	0.87	58	1.31	93	1.39	128	1.18	163	1.35
24	2.40	59	1.48	94	1.48	129	1.88	164	1.50
25	1.86	60	1.49	95	1.40	130	1.18	165	1.80
26	2.38	61	1.44	96	1.53	131	1.45	166	1.30
27	1.90	62	1.49	97	1.45	132	1.28	167	1.69
28	0.85	63	1.21	98	1.53	133	1.16	168	2.04
29	2.40	64	1.26	99	1.35	134	1.50	169	1.65
30	>2.50	65	1.30	100	1.52	135	1.40	170	1.51
31	0.98	66	1.40	101	1.75	136	1.03	171	0.92
32	1.59	67	1.76	102	2.07	137	1.19	172	0.90
33	1.83	68	1.60	103	1.03	138	0.85	173	1.56
34	1.70	69	1.50	104	2.00	139	1.24	174	1.39
35	1.86	70	1.40	105	1.28	140	1.31	175	1.42

APPENDIX 2 — Continued

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
176	1.55	214	1.52	252	1.53	290	>2.50	328	2.29
177	1.27	215	2.34	253	2.36	291	1.10	329	1.25
178	1.89	216	1.82	254	1.76	292	>2.50	330	1.77
179	0.81	217	1.60	255	1.26	293	2.15	331	>2.50
180	1.23	218	2.40	256	1.60	294	1.55	332	>2.50
181	1.30	219	1.55	257	1.11	295	2.02	333	1.34
182	1.25	220	1.95	258	1.38	296	1.64	334	1.49
183	1.30	221	1.54	259	0.90	297	0.71	335	1.94
184	1.23	222	2.06	260	1.13	298	1.42	336	2.42
185	1.41	223	>2.50	261	1.36	299	0.75	337	2.33
186	1.02	224	1.55	262	2.02	300	0.76	338	1.70
187	0.88	225	1.67	263	1.64	301	1.42	339	2.45
188	0.85	226	1.23	264	1.64	302	0.92	340	2.16
189	0.71	227	1.60	265	1.15	303	1.57	341	2.20
190	>2.50	228	1.58	266	1.37	304	0.97	342	1.63
191	2.35	229	1.48	267	1.15	305	1.50	343	1.67
192	2.17	230	2.03	268	1.37	306	1.45	344	1.51
193	2.35	231	1.47	269	1.20	307	0.87	345	1.93
194	>2.50	232	1.50	270	2.10	308	1.77	346	1.86
195	2.02	233	>2.50	271	1.70	309	0.80	347	1.83
196	>2.50	234	2.22	272	1.71	310	1.43	348	1.28
197	1.44	235	1.10	273	1.51	311	1.20	349	1.50
198	>2.50	236	2.25	274	1.34	312	2.10	350	1.49
199	>2.50	237	2.40	275	1.56	313	1.50	351	1.59
200	1.57	238	2.45	276	1.67	314	1.16	352	1.83
201	1.34	239	1.40	277	1.25	315	1.21	353	1.34
202	1.26	240	2.10	278	0.81	316	1.24	354	>2.50
203	1.88	241	1.73	279	1.44	317	1.08	355	1.38
204	2.44	242	1.28	280	1.28	318	1.57	356	1.43
205	2.20	243	1.27	281	2.13	319	2.19	357	1.75
206	1.33	244	1.95	282	2.16	320	1.08	358	1.59
207	>2.50	245	1.95	283	2.08	321	1.34	359	1.34
208	2.08	246	1.54	284	>2.50	322	0.80	360	1.36
209	2.03	247	2.10	285	1.79	323	2.03	361	2.39
210	2.16	248	1.54	286	1.39	324	1.41	362	1.61
211	1.70	249	1.65	287	1.82	325	2.42	363	0.68
212	1.72	250	2.45	288	1.23	326	>2.50	364	2.34
213	2.16	251	1.35	289	1.76	327	1.44	365	1.53

APPENDIX 2 — Continued

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
366	1.79	404	1.50	442	2.00	480	0	609	1.53
367	1.84	405	1.78	443	1.63	481	0	610	1.24
368	1.60	406	1.05	444	1.15	482	0	611	1.18
369	1.68	407	1.12	445	2.43	483	0	612	1.38
370	1.74	408	1.49	446	1.63	484	0	613	1.19
371	1.59	409	1.84	447	1.42	485	0	614	1.24
372	1.73	410	1.68	448	1.33	486	0	615	1.75
373	0	411	1.62	449	1.33	487	1.73	616	1.19
374	1.76	412	1.86	450	1.31	488	2.30	617	1.53
375	1.95	413	1.62	451	1.83	489	2.30	618	1.34
376	2.00	414	1.58	452	1.25	490	1.65	619	1.45
377	1.40	415	1.57	453	1.93	—	—	620	1.03
378	1.95	416	1.52	454	1.88	—	—	621	1.05
379	2.07	417	0	455	0.89	—	—	622	1.04
380	1.77	418	2.00	456	2.35	—	—	623	1.73
381	1.59	419	2.02	457	0.83	586	1.84	624	2.10
382	0	420	0	458	1.07	587	1.49	625	1.14
383	1.24	421	1.34	459	2.45	588	1.50	626	1.14
384	1.43	422	1.69	460	1.45	589	1.40	627	1.67
385	1.59	423	1.27	461	0	590	0.82	628	1.56
386	1.55	424	1.45	462	1.30	591	1.03	629	1.18
387	1.40	425	2.40	463	1.50	592	0	630	0
388	2.16	426	0	464	1.28	593	1.35	631	1.43
389	1.98	427	1.40	465	1.40	594	1.26	632	0.99
390	1.50	428	0.98	466	1.51	595	1.15	633	1.00
391	2.08	429	1.81	467	1.15	596	1.10	634	1.17
392	2.07	430	0.88	468	1.15	597	0.71	635	1.07
393	1.95	431	2.15	469	0.96	598	0.82	636	1.71
394	2.03	432	1.57	470	2.23	599	1.65	637	1.26
395	1.85	433	1.65	471	2.26	600	0.89	638	2.34
396	1.89	434	1.33	472	2.24	601	0.76	639	1.34
397	1.54	435	0.83	473	2.13	602	1.72	640	1.39
398	0	436	1.08	474	1.24	603	1.17	641	2.25
399	1.59	437	1.77	475	1.71	604	1.81	642	1.22
400	1.68	438	1.68	476	1.72	605	0.83	643	1.35
401	1.09	439	1.18	477	1.71	606	1.30	644	1.36
402	2.08	440	1.18	478	1.67	607	0	645	1.21
403	1.76	441	1.32	479	0	608	1.53	646	1.73

APPENDIX 2 — Continued

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
647	1.33	685	2.25	723	0	761	0.86	799	0.81
648	1.49	686	0	724	2.35	762	1.49	800	1.31
649	1.69	687	1.93	725	0	763	0.68	801	0.79
650	1.91	688	0	726	1.69	764	0.67	802	1.52
651	0	689	1.70	727	0.86	765	0.91	803	1.20
652	1.29	690	2.08	728	0.86	766	0.79	804	0.90
653	1.30	691	0	729	2.52	767	0.75	805	0.98
654	1.28	692	1.32	730	1.70	768	0.75	806	0.81
655	1.38	693	1.98	731	1.56	769	0.75	807	0.96
656	1.31	694	0	732	1.52	770	0	808	1.08
657	1.91	695	2.42	733	0	771	0.80	809	0.78
658	1.25	696	1.86	734	1.88	772	0.89	810	1.20
659	1.82	697	1.98	735	1.03	773	0.55	811	1.15
660	1.59	698	2.31	736	1.53	774	1.33	812	0.88
661	1.50	699	1.51	737	2.10	775	0	813	0
662	1.21	700	2.08	738	1.29	776	1.16	814	1.17
663	1.41	701	2.28	739	1.20	777	0.87	815	1.38
664	1.39	702	0	740	2.30	778	1.20	816	1.18
665	1.45	703	0	741	1.34	779	0	817	0.90
666	1.73	704	1.70	742	1.16	780	1.57	818	1.15
667	1.73	705	0	743	1.24	781	0	819	1.05
668	2.05	706	2.21	744	1.19	782	2.11	820	0
669	1.43	707	2.21	745	1.42	783	1.25	821	2.45
670	1.24	708	0	746	0	784	1.35	822	1.37
671	1.13	709	1.66	747	0.91	785	2.04	823	1.32
672	1.39	710	0	748	0.93	786	0	824	1.56
673	2.09	711	0	749	1.37	787	0.82	825	1.24
674	1.83	712	1.45	750	2.02	788	1.14	826	1.22
675	0	713	1.32	751	1.44	789	0.92	827	1.00
676	1.07	714	1.22	752	1.16	790	1.02	828	1.31
677	0	715	1.25	753	0	791	1.10	829	1.19
678	1.42	716	1.43	754	2.21	792	0	830	1.28
679	1.98	717	1.42	755	2.12	793	0.62	831	1.44
680	1.36	718	0.95	756	1.33	794	1.87	832	1.08
681	2.09	719	1.05	757	1.50	795	0.70	833	0
682	1.92	720	1.54	758	2.09	796	0.66	834	1.64
683	0	721	0	759	0	797	0	835	0.86
684	1.66	722	1.06	760	2.04	798	0.88	836	1.79

APPENDIX 2 — Continued

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
837	1 03	875	2 14	913	0 84	951	0	989	—
838	0 52	876	2 12	914	1 07	952	0	990	1 50
839	1 01	877	0	915	1 24	953	1 78	991	1 40
840	0 79	878	1 95	916	1 29	954	0	992	1 00
841	0 83	879	1 55	917	0	955	1 04	993	1 40
842	0	880	1 40	918	1 49	956	0 77	994	1 40
843	1 78	881	1 31	919	0	957	0	995	1 10
844	0	882	1 05	920	0	958	0 98	996	1 30
845	1 39	883	1 17	921	0	959	1 18	997	2 20
846	0	884	1 19	922	0	960	1 53	998	1 10
847	1 58	885	1 24	923	0 87	961	1 00	999	1 90
848	1 30	886	1 31	924	1 02	962	0 55	1000	1 90
849	0	887	1 03	925	0	963	0	1001	1 50
850	1 19	888	2 01	926	1 24	964	0 79	1002	2 10
851	1 16	889	1 53	927	0 83	965	1 10	1003	0 70
852	0	890	1 16	928	0 78	966	1 38	1004	—
853	1 09	891	1 66	929	1 24	967	1 90	1005	0 90
854	1 29	892	1 58	930	1 16	968	1 80	1006	1 30
855	0	893	1 27	931	0	969	1 40	1007	0 80
856	1 89	894	2 29	932	0	970	1 30	1008	1 10
857	1 30	895	1 02	933	1 31	971	1 30	1009	0 50
858	0 93	896	1 75	934	0	972	—	1010	1 10
859	0	897	1 01	935	0	973	1 00	1011	1 10
860	1 21	898	1 74	936	0	974	0 70	1012	1 40
861	1 15	899	1 24	937	0	975	0	1013	0 70
862	1 09	900	0 84	938	0	976	1 30	1014	0 90
863	1 84	901	0	939	1 29	977	0 80	1015	1 30
864	1 54	902	0 95	940	0 97	978	0 70	1016	1 10
865	1 49	903	0	941	0 90	979	1 70	1017	0 80
866	1 64	904	0 86	942	0	980	0 80	1018	0 80
867	0	905	0	943	1 20	981	—	1019	1 50
868	1 28	906	0 70	944	0 97	982	—	1020	1 70
869	1 39	907	0	945	1 20	983	0 70	1021	2 40
870	0	908	0 73	946	1 33	984	0 70	1022	—
871	1 97	909	0 61	947	1 35	985	0 70	1023	0 90
872	1 66	910	0 82	948	1 50	986	1 30	1024	0 90
873	1 67	911	0	949	1 11	987	1 10	1025	1 00
874	0	912	0 84	950	0	988	1 50	1026	2 10

APPENDIX 2 — Continued

Site No.	FS	Site No.	FS	Site No.	FS	Site No.	FS
1027	1.80	1063	2.00-2.50	1099	1.40	1135	2.30
1028	1.30	1064	Bedrock	1100	1.40	1136	2.30
1029	0	1065	0	1101	1.40	1137	2.10
1030	0	1066	2.10	1102	1.40	1138	2.10
1031	0.90	1067	0.90	1103	—	1139	0.90
1032	0.70	1068	Bedrock	1104	2.30	1140	1.20
1033	1.10	1069	1.60	1105	1.50	1141	1.00
1034	1.90	1070	0.80	1106	0.70	1142	0.80
1035	1.10	1071	1.20	1107	0.80	1143	1.90
1036	1.40	1072	1.60	1108	1.40	1144	2.45
1037	1.10	1073	Bedrock	1109	1.30	1145	2.07
1038	Bedrock	1074	Bedrock	1110	1.90	1146	1.75
1039	—	1075	—	1111	1.20	1147	2.27
1040	—	1076	1.30	1112	2.30	1148	2.08
1041	2.40	1077	1.10	1113	1.70	1149	0
1042	1.30	1078	1.90	1114	1.40	1150	1.22
1043	1.10	1079	0.90	1115	0	1151	2.00
1044	—	1080	1.20	1116	1.70	1152	2.15
1045	—	1081	0	1117	0.80	1153	1.22
1046	—	1082	2.50	1118	2.30	1154	2.30
1047	—	1083	—	1119	2.30	1155	0.97
1048	—	1084	—	1120	0	1156	1.78
1049	1.70	1085	0	1121	0.80	1157	1.46
1050	1.60	1086	—	1122	2.10	1158	1.78
1051	1.20	1087	—	1123	1.90	1159	1.71
1052	1.60	1088	—	1124	0	1160	1.18
1053	1.10	1089	—	1125	1.30	1161	1.25
1054	2.50	1090	0.90	1126	2.30	1162	1.60
1055	2.00	1091	0.90	1127	1.30	1163	2.18
1056	1.20	1092	—	1128	1.30	1164	1.70
1057	1.70	1093	—	1129	0	1165	1.70
1058	Bedrock	1094	1.10	1130	0	1166	2.18
1059	Bedrock	1095	1.30	1131	1.80	1167	1.60
1060	0	1096	—	1132	0	—	—
1061	0	1097	—	1133	0	—	—
1062	0	1098	—	1134	2.30	—	—

REFERENCES

Arseneault, J.G.
1967: A Program for Solving Slope Stability Problems; Division of Building Research, National Research Council of Canada, Computer Program Number 27, Ottawa, 20p.

Chapman, L.J., and Putnam, D.F.
1966: The Physiography of Southern Ontario, University of Toronto Press, 2nd Edition, 386p.

Eden, W.J., Fletcher, E.B., and Mitchell, R.J.
1971: South Nation River Landslide; Canadian Geotechnical Journal, Volume 8, Number 3, p.446-451.

Eden, W.J., and Jarrett, P.M.
1971: Landslide at Orleans, Ontario; Division of Building Research, National Research Council of Canada, Research Paper Number 321, Ottawa, 25p.

Eden, W.J., and Mitchell, R.J.
1970: The Mechanics of Landslides in Leda Clay; Canadian Geotechnical Journal, Volume 7, Number 3, p.285-296.

1973: Landslides in Sensitive Marine Clay in Eastern Canada; Highway Research Record 463, p.18-27.

Fondex Limited
1974: Report on the Foundation Conditions at Proposed Bridge Crossing of the South Nation River and Boundary Road near Village of Lemieux, Ontario; Unpublished report, File Number 3305-S, GEOCRES Number 31G-3.

Fransham, P.B., and Gadd, N.R.
1977: Geological and Geomorphological Controls of Landslides in Ottawa Valley, Ontario; Canadian Geotechnical Journal, Volume 14, Number 4, p.531-539

Fransham, P.B., Gadd, N.R., and Carr, P.A.
1976a: Geological Variability of Marine Deposits, Ottawa-St. Lawrence Lowlands; Report of Activities, Part A, Geological Survey of Canada, Paper 76-11A, p.37-41.

1976b: Distribution of Sensitive Clay Deposits and Associated Landslides in the Ottawa Valley, Hawkesbury, Ontario, 31 G/10, Alexandria, Ontario, 31 G/7, Thurso, Quebec-Ontario, 31 G/11, Russell, Ontario, 31 G/6, Ottawa, Ontario-Quebec, 31 G/5, Arnprior, Ontario, 31 C/8; Geological Survey of Canada, Open File Report (Maps) 352, scale 1:50 000.

Gadd, N.R.
1971: Pleistocene Geology of the Central St. Lawrence Lowland; Geological Survey of Canada, Memoir 359, 153p. Accompanied by Map 1197A.

1976: Quaternary Stratigraphy in Southern Quebec; p.37-50 *in* Quaternary Stratigraphy of North America, edited by W.C. Mahaney, Dowden, Hutchinson and Ross, Stroudsburg, Pennsylvania.

1977: Offlap Sedimentary Sequence in Champlain Sea, Ontario and Quebec; Report of Activities, Part A, Geological Survey of Canada, Paper 77-1A, p.379-380.

1978a: Mass Flow Deposits in a Quaternary Succession near Ottawa, Canada: Diagnostic Criteria for Subaqueous Outwash: Discussion; Canadian Journal of Earth Sciences, Volume 15, Number 2, p.237-238.

1978b: Chalk River and the Ottawa Basin; p.139-145 *in* Atomic Energy of Canada Limited, Paper Number 4836.

Golder Associates
1974a: Subsurface Investigations Proposed South-East City, Township of Gloucester; Unpublished report, Volume 3, Report Number 73908, 22p.

1974b: Slope Stability Study Queenswood Heights, Gloucester Township, Ontario; Unpublished report, Report Number 742062.

Gwyn, Q.H.J., and Lohse, H.
1973: Quaternary Geology of the Alexandria Area, Southern Ontario; Ontario Division of Mines, Preliminary Map P.906, Geological Series, scale 1:50 000. Geology 1973.

Gwyn, Q.H.J., and Thibault, J.
1975: Quaternary Geology of the Hawkesbury-Lachute Area, Southern Ontario; Ontario Division of Mines, Preliminary Map P.1010, Geological Series, scale 1:50 000. Geology 1974.

Jarret, P.M.
1972: The Effects of Soil Structure on the Engineering Behaviour of a Sensitive Clay; Engineering Geology, Volume 5, p.103-109.

Johnston, W.A.
1917: Pleistocene and Recent Deposits in the Vicinity of Ottawa, with a Description of the Soils; Geological Survey of Canada, Memoir 101.

Karrow, P.F.
1961: The Champlain Sea and its Sediments; p.97-108 *in* Soils of Canada, edited by R.F. Legget, Special Publication Number 3, Royal Society of Canada, 229p.

Kenney, T.C.
1964: Sea-Level Movements and the Geologic Histories of the Post-Glacial Marine Soils at Boston, Nicolet, Ottawa, and Oslo; Geotechnique, Volume 14, p.203-227.

Klugman, M.A., and Chung, P.
1976: Slope Stability Study of the Regional Municipality of Ottawa-Carleton, Ontario, Canada; Ontario Geological Survey, Miscellaneous Paper 68, 13p.

La Rochelle, P., Chagnon, J.Y., and Lefebvre, G.
1970: Regional Geology and Landslides in the Marine Clay Deposits of Eastern Canada; Canadian Geotechnical Journal, Volume 7, Number 2, p.145-146.

Mitchell, R.J.
1970: Landslides at Breckenridge, Pineview Golf Club, and Rockcliffe; Division of Building Research, National Research Council of Canada, Technical Paper Number 322, Ottawa, 30p.

1975: Strength Parameters for Permanent Slopes in Champlain Sea Clays; Canadian Geotechnical Journal, Volume 12, Number 4, p.447-455.

Mitchell, R.J., and Eden, W.J.
1972: Measured Movements of Clay Slopes in the Ottawa Area; Canadian Journal of Earth Sciences, Volume 9, Number 8, p.1001-1013.

Mitchell, R.J., and Klugman, M.A.
1979: Mass Instabilities in Sensitive Canadian Soils; Engineering Geology, Volume 14, Numbers 2 and 3, p.109-134.

Mitchell, R.J., and Markell, A.R.
1974: Flowslides in Sensitive Soils; Canadian Geotechnical Journal, Volume 11, Number 1, p.11-31.

Ontario Ministry of Transportation and Communications
1973. Foundation Investigation Report for Slope Instability, South Bank of Ottawa River; Unpublished report, GEOCRES Number 165, 20p.

Paul, M.I.
1970: Landsliding in Sensitive Clay Soils at Ottawa; Unpublished M.Sc. Thesis, Queen's University, Kingston, Ontario, 138p.

Poschmann, A.S.
1978: Air Photo Classification and Glossary of Landslide Problems in the Ottawa and St. Lawrence Lowlands; Unpublished B.Sc. Thesis, Queen's University, Kingston, Ontario, 76p.

Richard, S.H.
1982a: Surficial Geology, Ottawa, Ontario; Geological Survey of Canada, Map 1506A, scale 1:50 000.

1982b: Surficial Geology, Russell, Ontario; Geological Survey of Canada, Map 1507A, scale 1:50 000.

1982c: Surficial Geology, Winchester, Ontario; Geological Survey of Canada, Map 1491A, Scale 1:50 000.

1982d: Surficial Geology, Morrisburg, Ontario-New York; Geological Survey of Canada, Map 1493A, scale 1:50 000.

Sangrey, D.A., and Paul, M.J.
1971: A Regional Study of Landsliding near Ottawa; Canadian Geotechnical Journal, Volume 8, Number 2, p.315-335.

Sangrey, D.A., and Townsend, D.L.
1969: Characteristics of Three Sensitive Canadian Clays; Research Report Number 63, Department of Civil Engineering, Queen's University, Kingston, Ontario, 137p.

Sharpe, D.R.
1979: Quaternary Geology of the Merrickville Area, Southern Ontario; Ontario Geological Survey, Report 180, 54p. Accompanied by Maps 2387-2388, scale 1:50 000.

Smalley, I.
1976: Factors Relating to the Landslide Process in Canadian Quickclay; Earth Surface Processes, Volume 1, p.163-172.

Wong, G.C.Y., Claridge, F.B., and Benson, R.P.
1975: Stability of Reservoir Banks in a Sensitive Marine Clay; Section *in* Engineering Problems in Marine Clay, Geotechnical Seminar, Arnprior Generating Station, June 13 and 14, 1975 (Internal Report), Acres Consulting Services Limited, Niagara Falls.

ONTARIO GEOLOGICAL SURVEY

Map 2486

SLOPE STABILITY STUDY OF THE SOUTH NATION RIVER AND PORTIONS OF THE OTTAWA RIVER

Northern Sheet

Scale 1:3,168,000 (1 inch to 50 miles)

SOUTHERN ONTARIO
GEOTECHNICAL SERIES

NTS Reference: 31 G/2, 31 G/3, 31 G/4
31 G/5, 31 G/6, 31 G/7
31 G/10, 31 G/11, 31 G/12

Scale 1:50,000

Ontario Ministry of Natural Resources

Conservation Authority

Buckingham

Thurso

Rockland

Baie-Noire

BAIE NOIRE

OUTAOUAIS

RIVIERE DES OTTAWA

RIVIERE

Parker Island

THURSO ISLANDS

PRESQU'ILE DU GRAND CAMPEMENT

Roland East

Burkett's Creek

Clarence Creek

St-Pascal

St-Pascal-Baylon TP

CANTON DE LA BAIE DE BUCKINGHAM

COMTE DE PAPINEAU

RUSSELL COUNTY

QUEBEC

ONTARIO

CITY OF CLARENCE

REGIONAL MUNICIPALITY OF PRESCOTT AND RUSSELL

CLARENCE TP

CLARENCE CREEK

NORTH PLANTAGENET TP

RUSSELL COUNTY

148

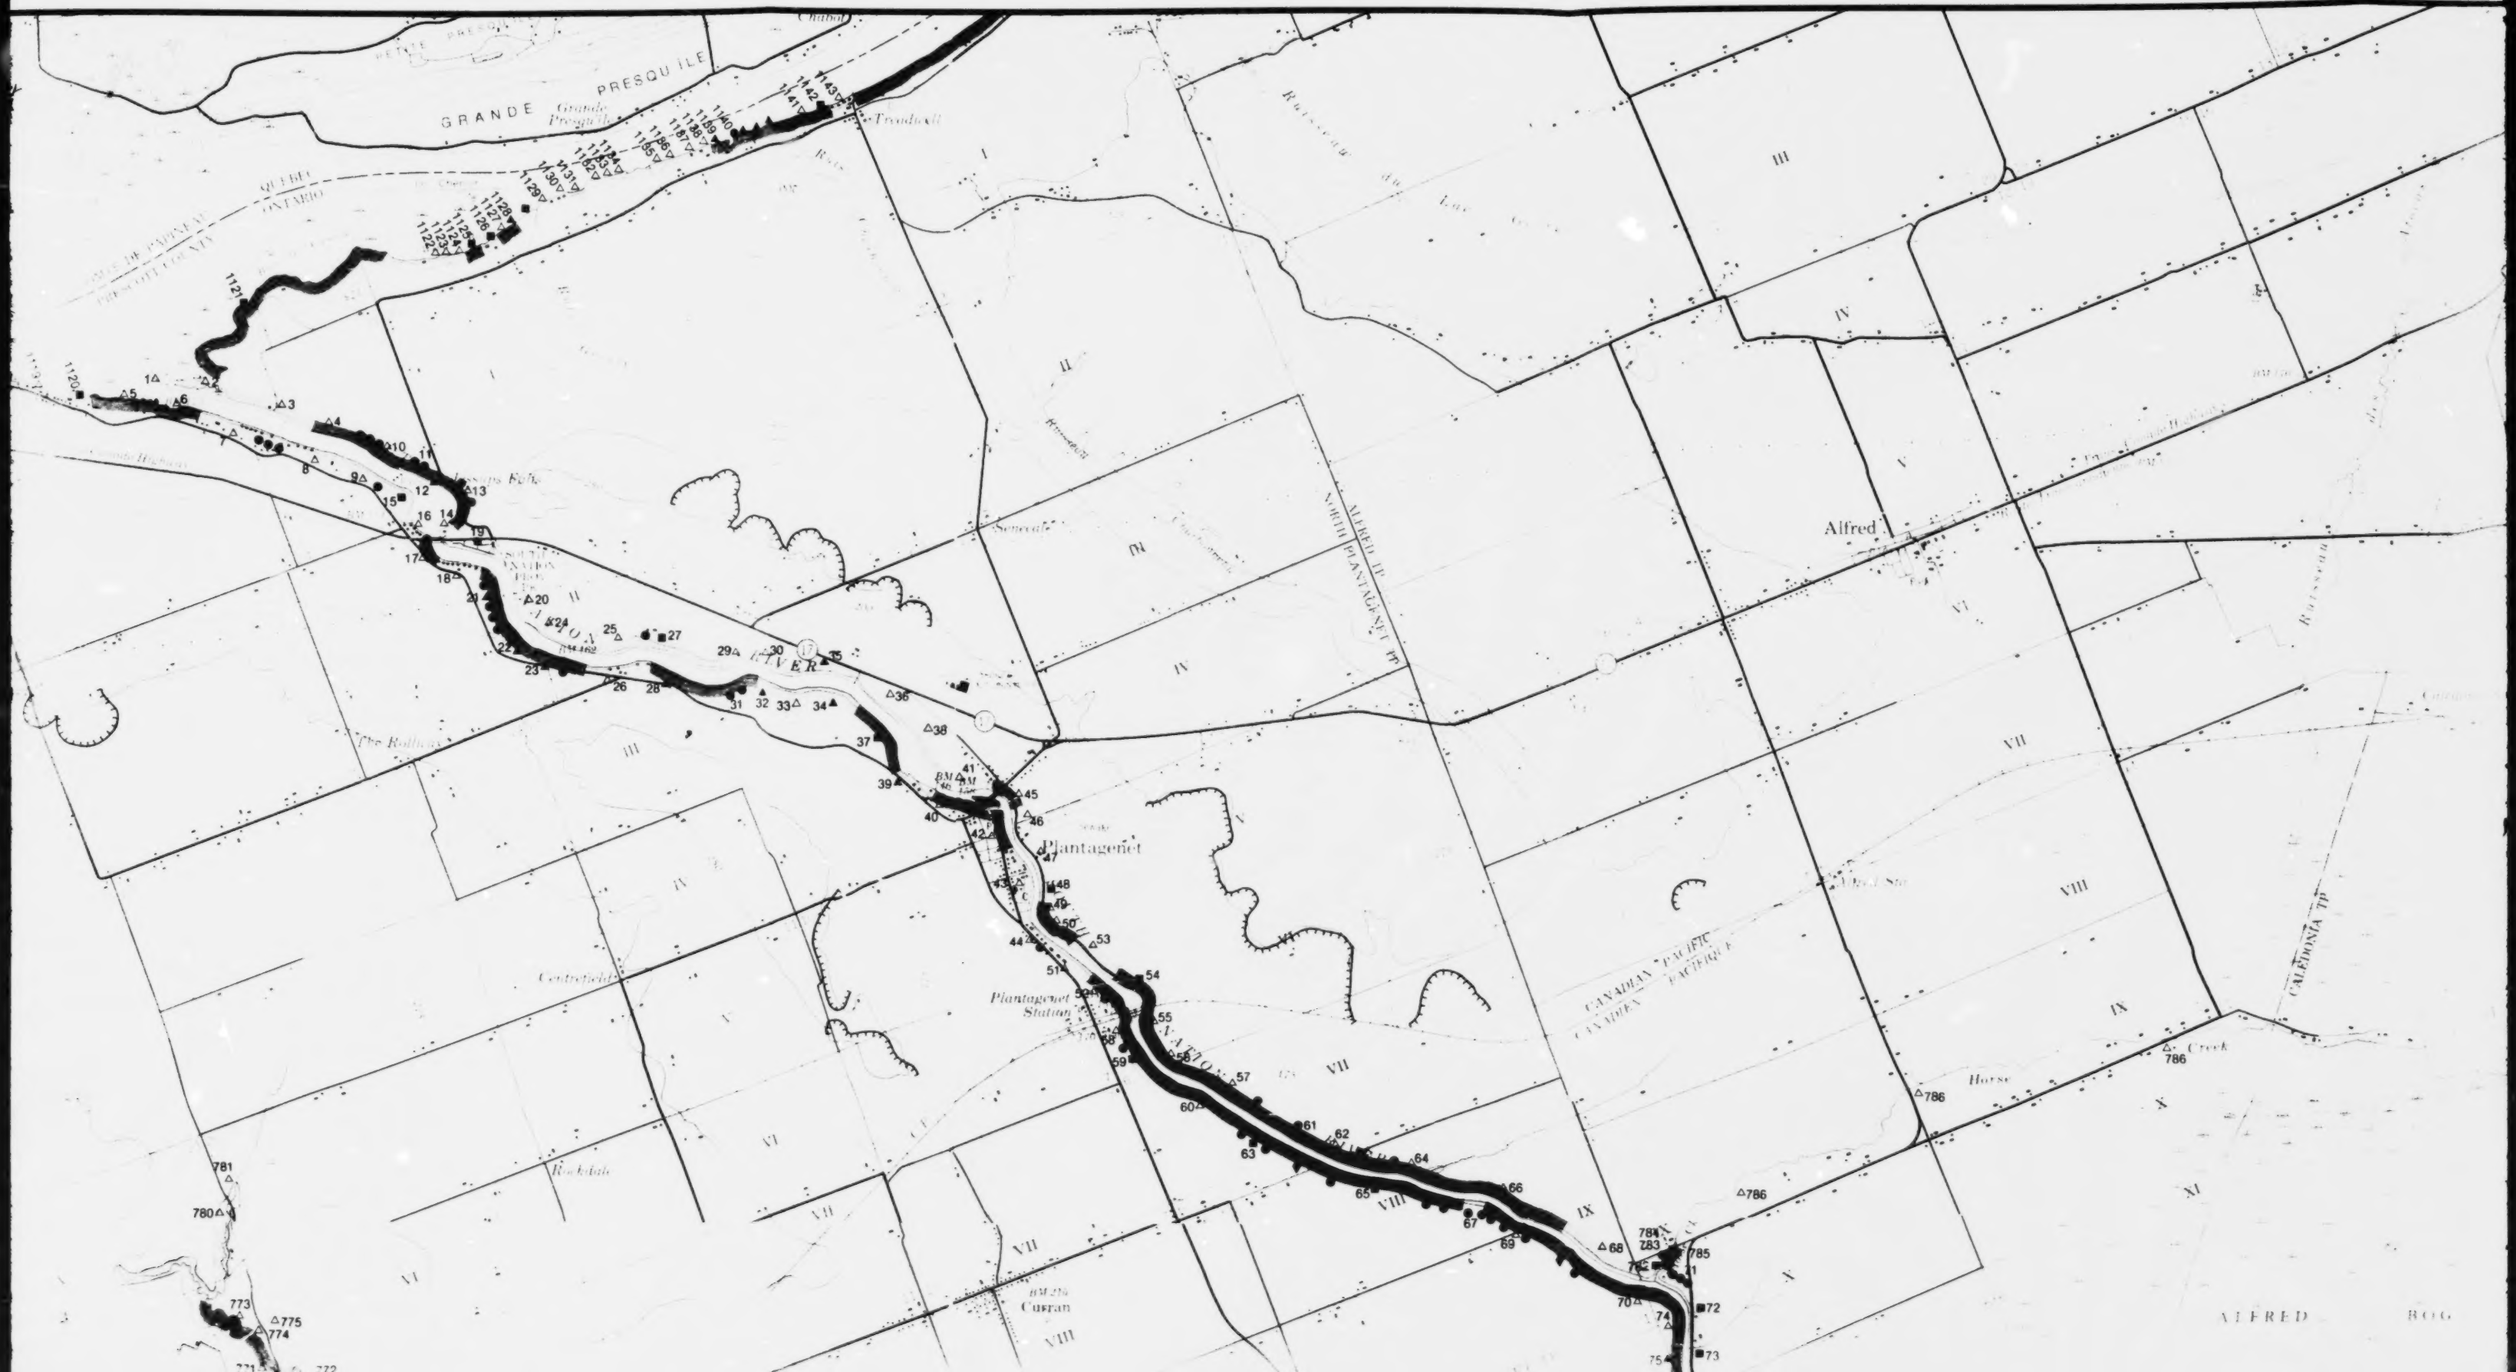
GRANDE PRESQUILE
Grande Presquile
Petite Presquile
QUEBEC
ONTARIO
Chute
Traders Hill
Rapids on the Lake
Alfred
Plantagenet
Plantagenet Station
Curran
Rockdale
Centrefield
The Rollway
Horse Creek
CANADIAN PACIFIC
CANADIEN PACIFIQUE
CALEDONIA TP
ALFRED BOG
I
II
III
IV
V
VI
VII
VIII
IX
X
XI

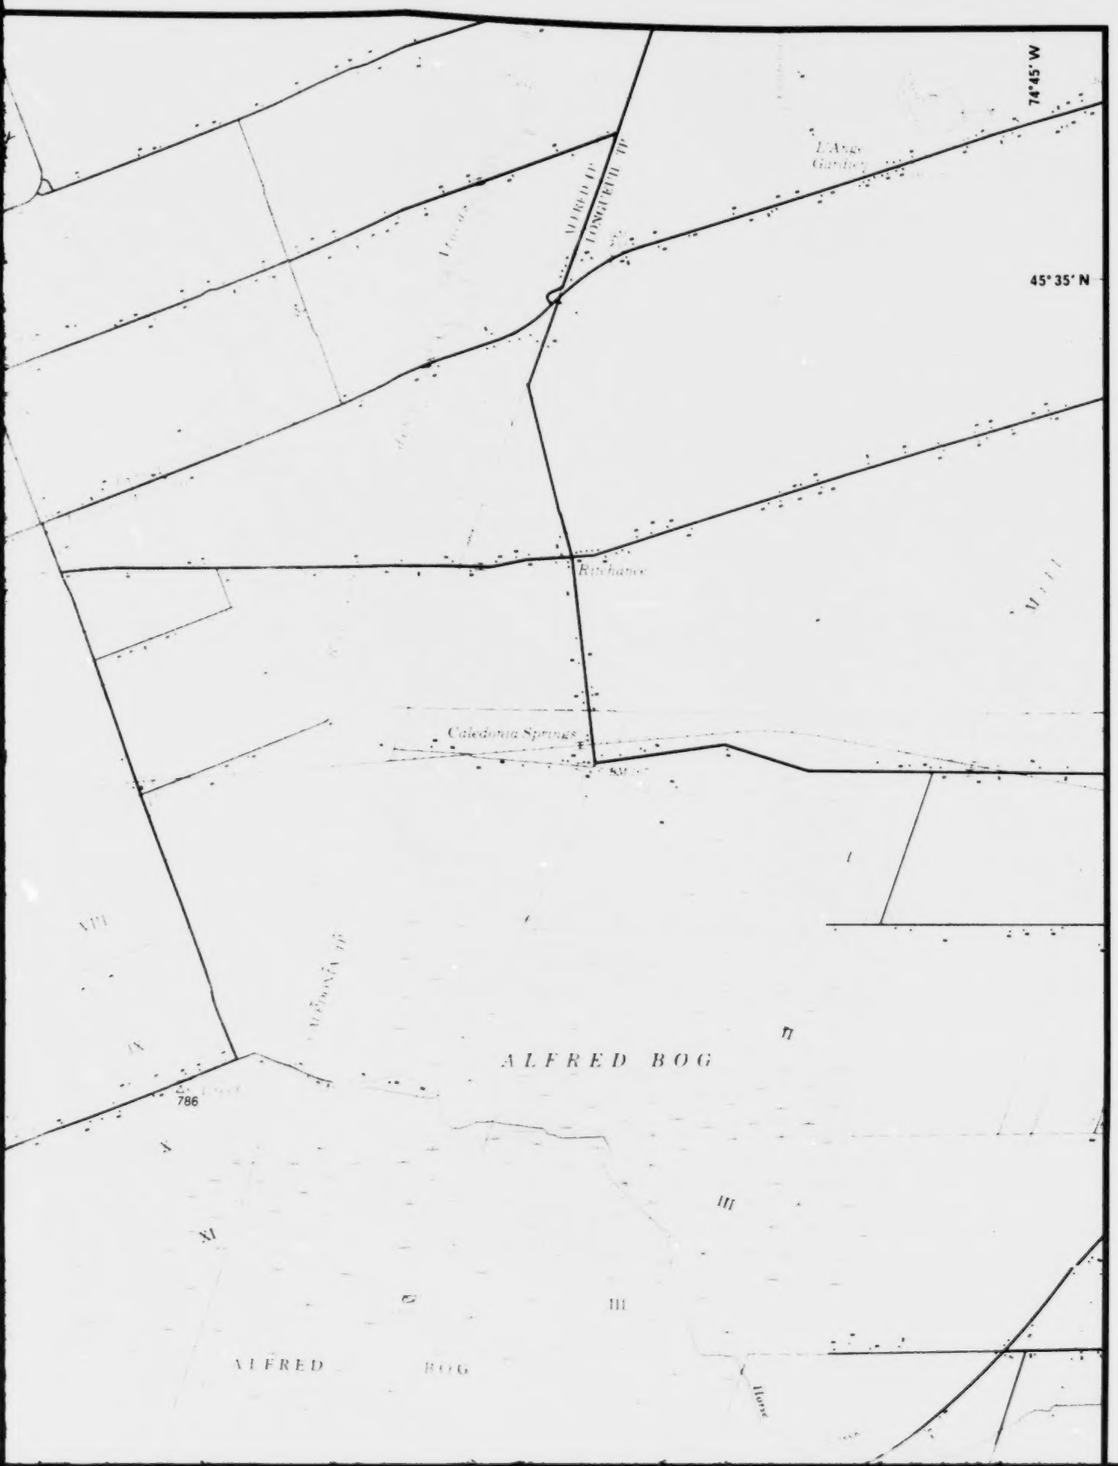
74°45' W
45°35' N
TOWNSHIP
Caledonia Springs
ALFRED BOG
786
ALFRED BOG

Ontario

75°35'W

45°11'N

WINCHESTER BOG

Reids Mills

Winchester

Ministry of Natural Resources
Ontario

South Nation River Conservation Authority

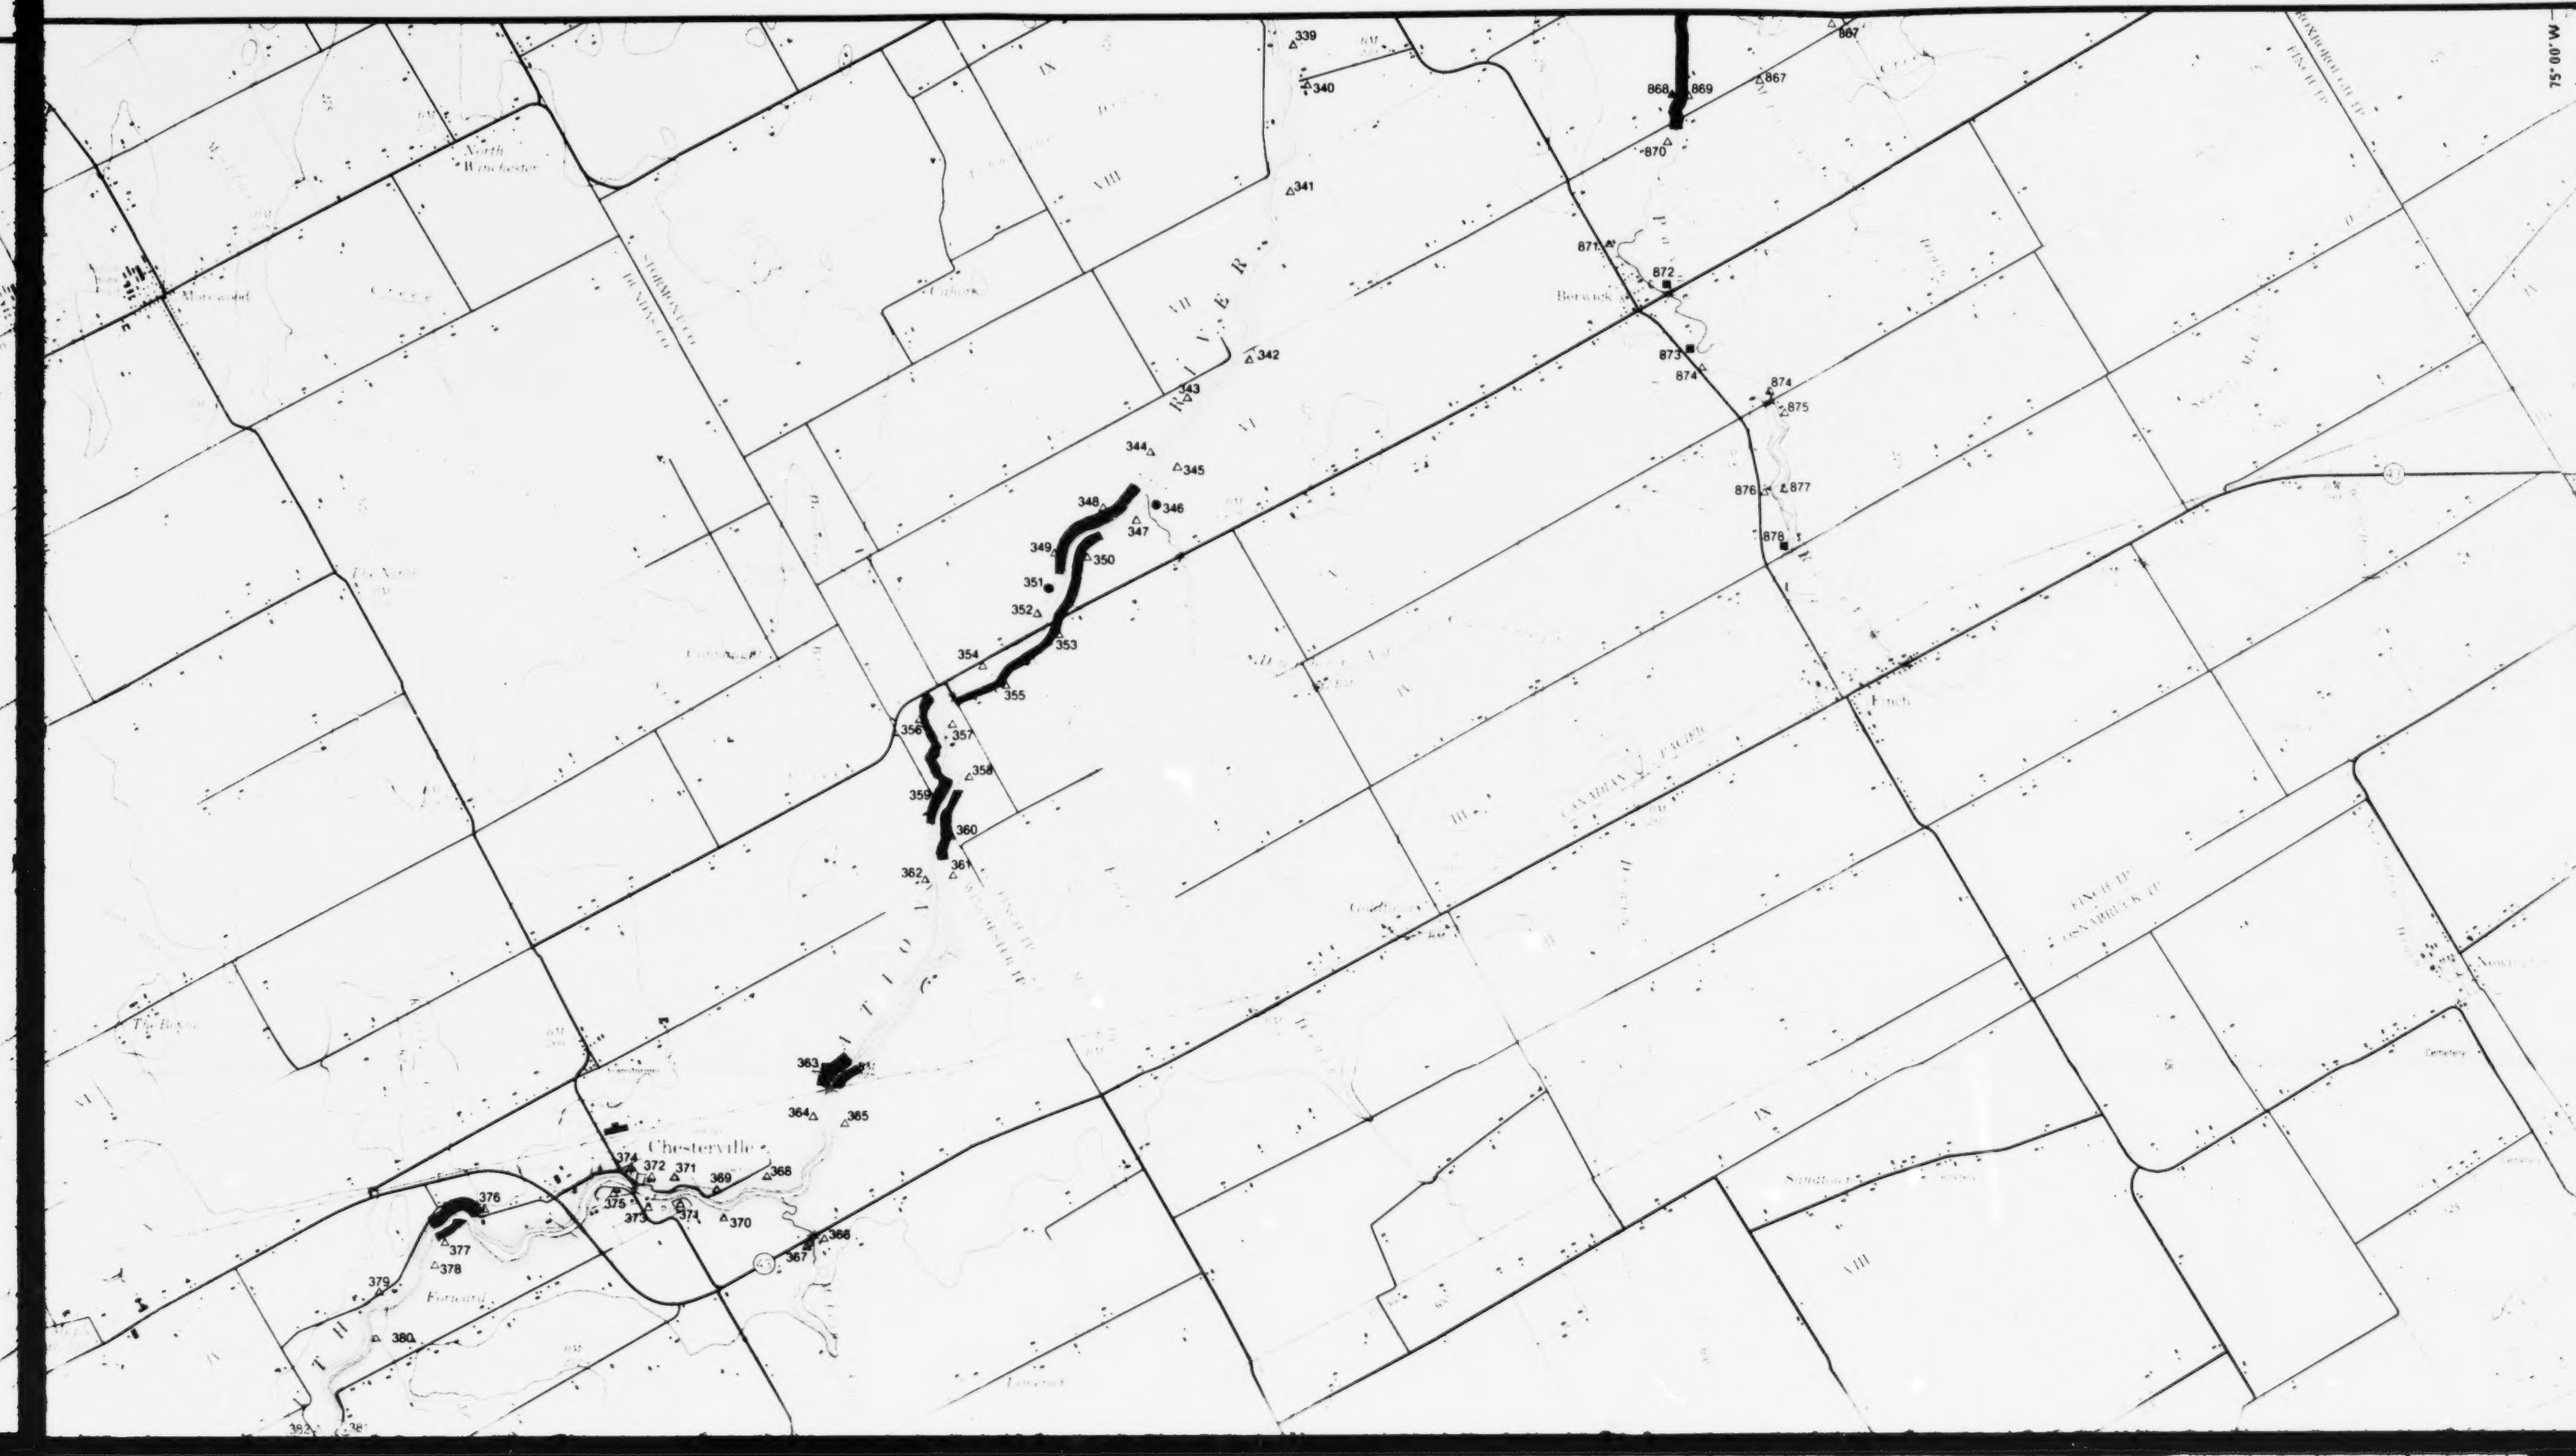

ONTARIO GEOLOGICAL SURVEY

Map 2487

SLOPE STABILITY STUDY OF THE SOUTH NATION RIVER AND PORTIONS OF THE OTTAWA RIVER

Southern Sheet

SOUTHERN ONTARIO
GEOTECHNICAL SERIES

NTS Reference: 31 B/13, 31 B/14, 31 B/15
31 G/2, 31 G/3, 31 G/4

Scale 1:50,000

Scale 1:3,168,000 (1 inch to 50 miles)

LEGEND

SLOPE STABILITY CLASSIFICATIONS*

	FACTOR OF SAFETY	GUIDELINES
	<0.8	Unsuitable for construction or will require extreme remedial measures based upon careful geotechnical investigations.

GATINEAU

OUTAOUAIS

RIVIERE DES OUTAOUAIS

Beacon Hill North

Rothwell Heights

ROCKCLIFFE PARK

Beacon Hill South

Blackburn Hamlet

Orleans

Bearbrook Creek

Nicolet Drain

CANADIAN NATIONAL

CUMBERLAND TP

GLOUCESTER TP

MER BLEUE

D N D

CANIER

TAWA

LEGEND

SLOPE STABILITY CLASSIFICATIONS*

FACTOR OF SAFETY	GUIDELINES
<0.8	Unsuitable for construction or will require extreme remedial measures based upon careful geotechnical investigations

Currie Creek

St Pascal

Bourget

Vimont

Sarsfield

Leonard

Bearbrook

BM 241

NORTH PLANTAGENET TP
SOUTH PLANTAGENET TP
VERED TP
CAMBRIA TP
St Isidore de Prescott

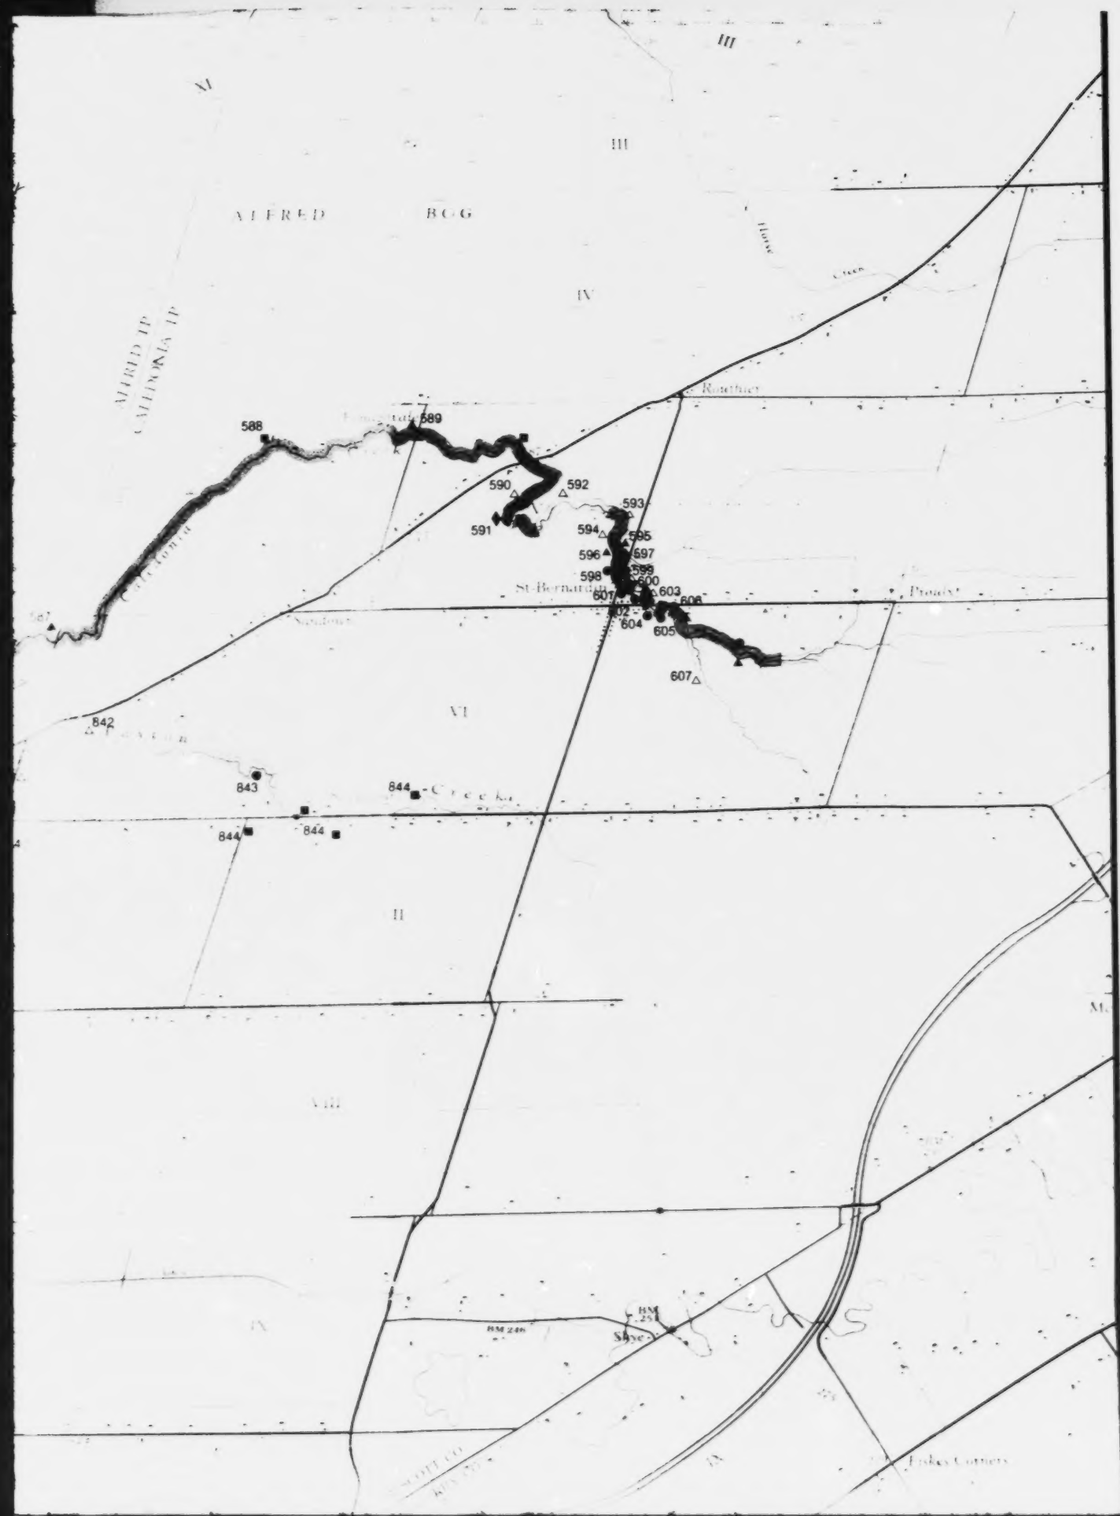
ALFRED
BOG
ALFRED TP
CALEDONIA TP
Rouleau
St Bernardin
Prouse
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
842
843
844
844
844
Creeks
BM 24m
BM
SSW
Lakes Corners

WINCHESTER BOG

420
421
422
423
424
425
426
427
428
398
397
396
395
394
419
418
403
402
404
405
406
401
400
399
391
392

Chesterville

374 372 371 369 368
375 373 371 370
376 377 378 379 380
367 366
382 381 383 384 385 386
389 387 390 388 391

LEGEND

SLOPE STABILITY CLASSIFICATIONS*

FACTOR OF SAFETY	GUIDELINES
<0.8	Unsuitable for construction or will require extreme remedial measures based upon careful geotechnical investigations.
0.8-1.2	Will require extensive remedial measures as dictated by detailed geotechnical studies.
1.2-1.5	Detailed geotechnical investigation necessary, with concomitant remedial measures.
1.5-2.0	Routine geotechnical investigation necessary.
2.0-2.5 or interpreted from field study	Routine inspection necessary.
> 2.5 or interpreted from field study	Should be inspected but no remedial action likely to be required.

***Note:** An explanation of the derivation of the Factor of Safety values is given in the text accompanying this map. Readings taken in the field are *time dependent* for the conditions of the slope at the time of recording the data.

The specific values are presented as a *guide* to the slope conditions and not as a basis for engineering design. Under all circumstances site specific studies and / or inspections should be carried out at all sites before any development is undertaken.

This map sheet partially overlaps the Ottawa-Carlton region and portrays revised field data in selected areas.

LEGEND

SLOPE STABILITY CLASSIFICATIONS*

FACTOR OF SAFETY		GUIDELINES
	<0.8	Unsuitable for construction or will require extreme remedial measures based upon careful geotechnical investigations.
	0.8-1.2	Will require extensive remedial measures as dictated by detailed geotechnical studies.
	1.2-1.5	Detailed geotechnical investigation necessary, with concomitant remedial measures.
	1.5-2.0	Routine geotechnical investigation necessary.
	2.0-2.5 or interpreted from field study	Routine inspection necessary.
	> 2.5 or interpreted from field study	Should be inspected but no remedial action likely to be required.

***Note:** An explanation of the derivation of the Factor of Safety values is given in the text accompanying this map. Readings taken in the field are *time dependent* for the conditions of the slope at the time of recording the data.

The specific values are presented as a *guide* to the slope conditions and not as a basis for engineering design. Under all circumstances site specific studies and / or inspections should be carried out at all sites before any development is undertaken.

This map sheet partially overlies The Ottawa - Carlton region and portrays revised field data in selected areas.

SYMBOLS

- △ . . . Survey point.
- $\overset{284}{\triangle}$ . . . Recorded data, see report.
- . . . Earth flow slide.
- ◆ . . . Retrogressive rotational and retrogressive flowslides.
- ▲ . . . Sheet slide.

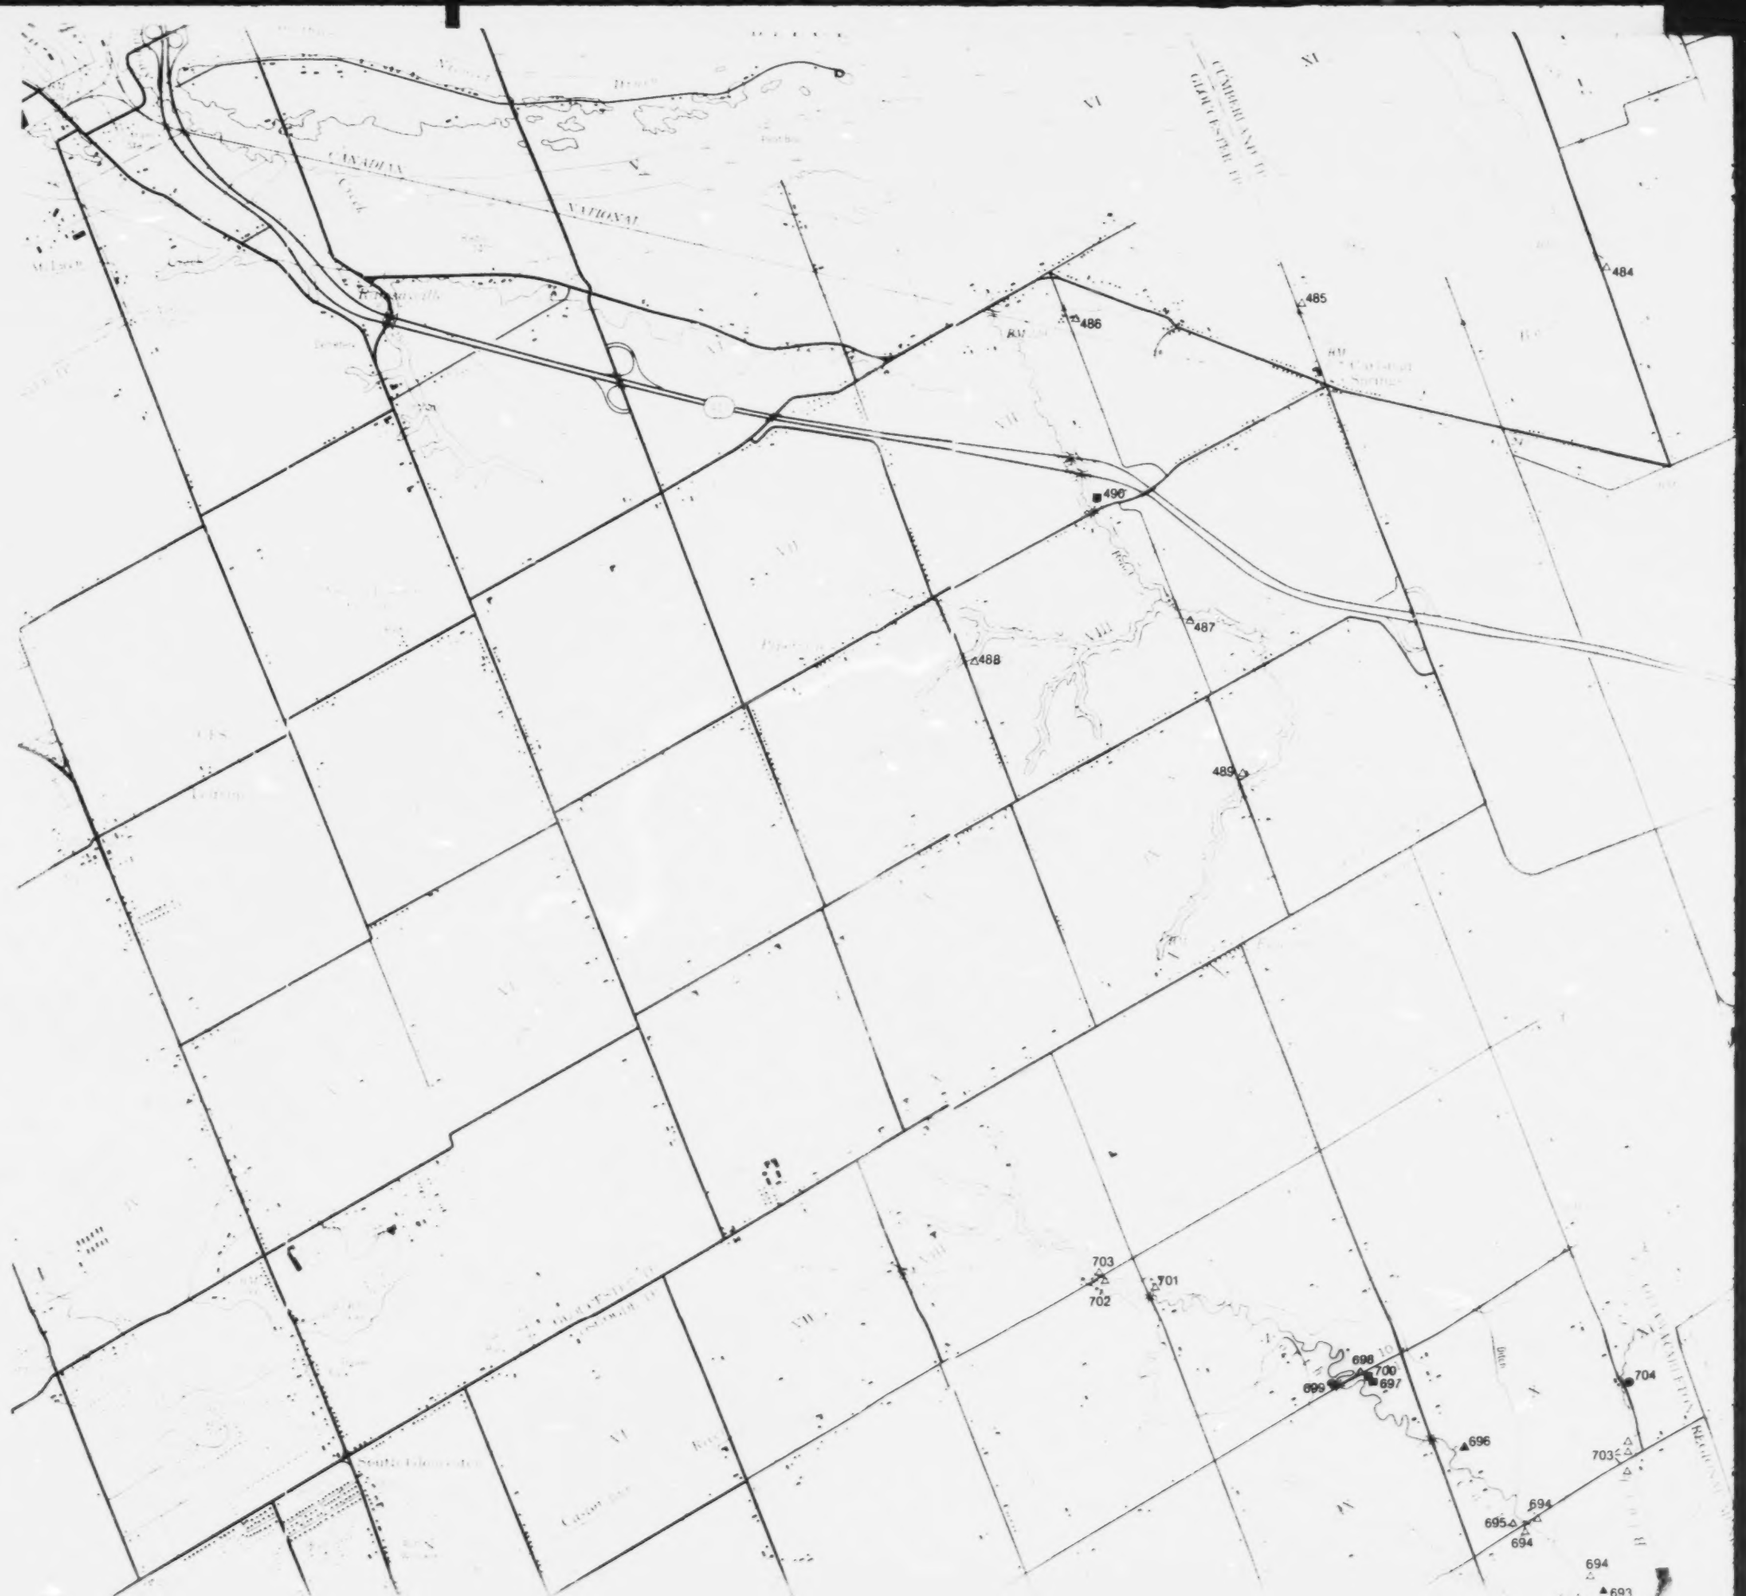

484
480
479
474
473
466
789
790
791
792
963
961
962
959
958
957
960
956
955
171
966
965
964
172
173
170
174
175
176
177
704
703
696
694
695
693
Embrun
648
647
646
645
643
644
651
650
649
652
660
657
666
662
642
641
640
639
638
637
636
635
634
633
632
631
630
627
629
628
624
625
626
623
622
621
620
619
618
617
734
733
737
735
736
738
739
741
740
742
743
744
745

St Isidore de Prescott

Maxville

Parkes Corners
Greenfield
Maxville
XVII
XVI

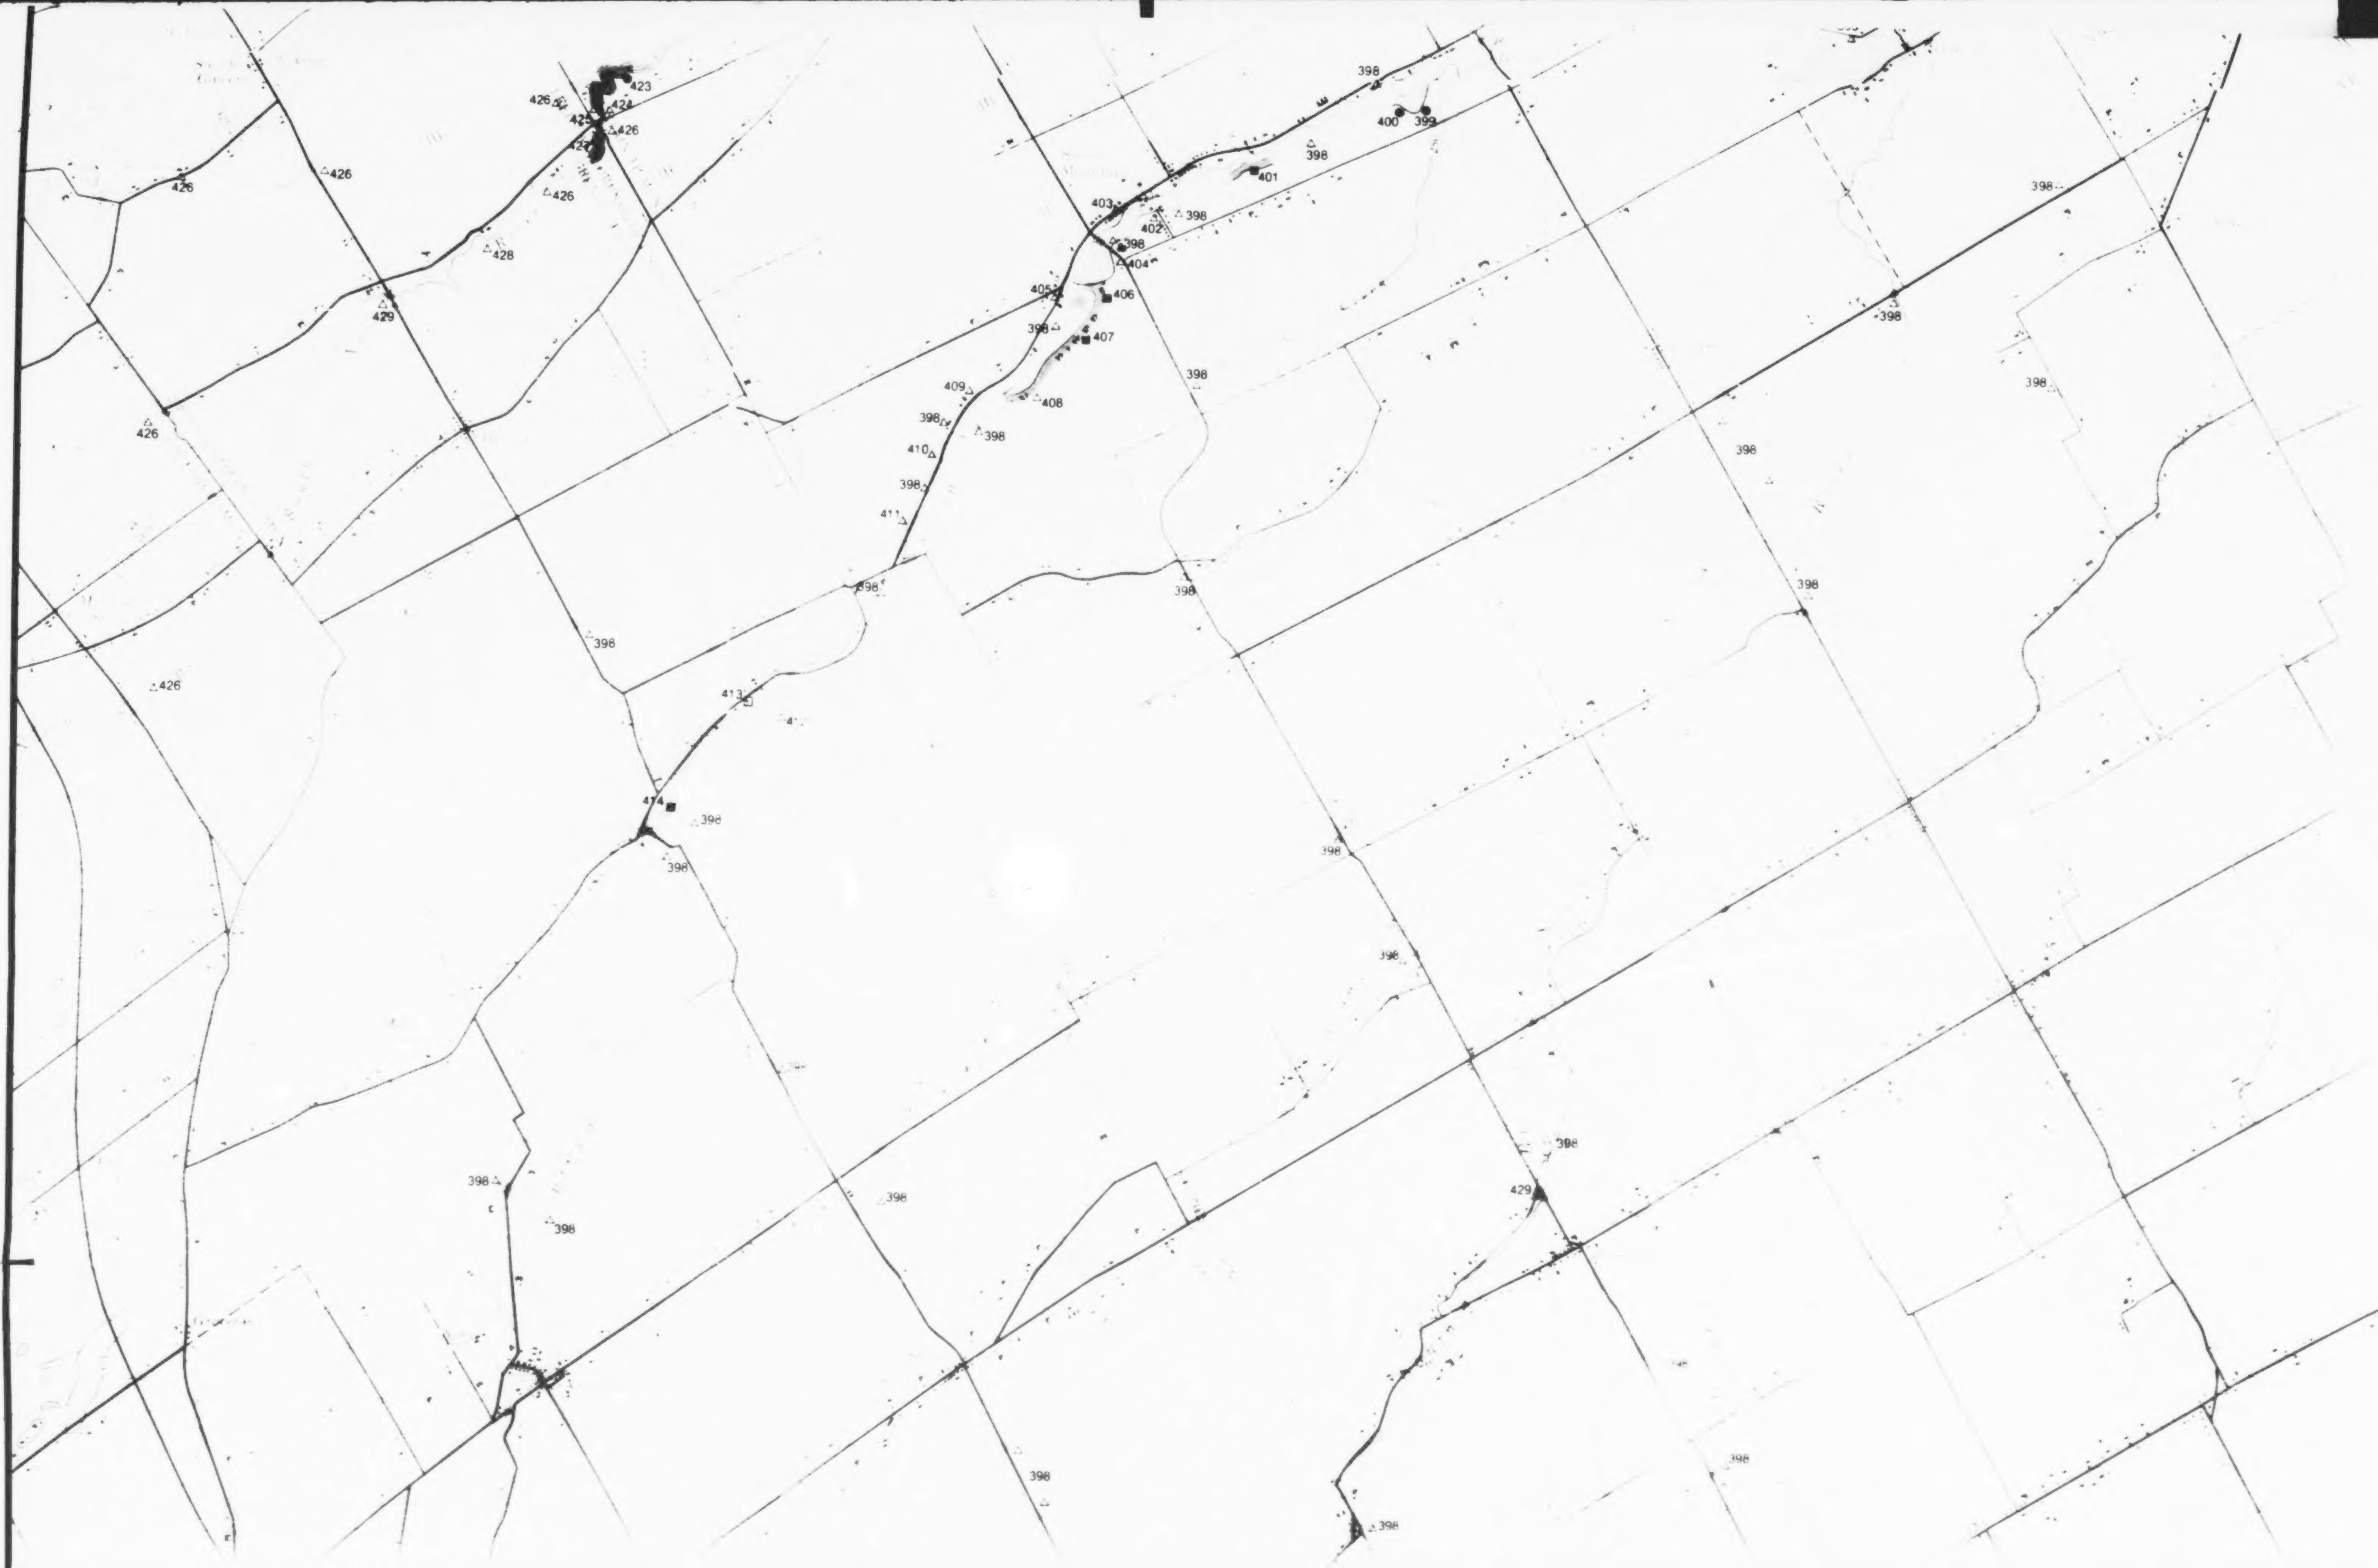

423
426
424
426
426
426
426
428
429
426
426
398
400
399
398
401
403
402
398
398
404
405
406
398
407
398
409
408
398
398
410
398
411
398
398
398
398
398
398
413
414
398
398
398
398
398
398
398
398
429
398
398
398
398
398
398

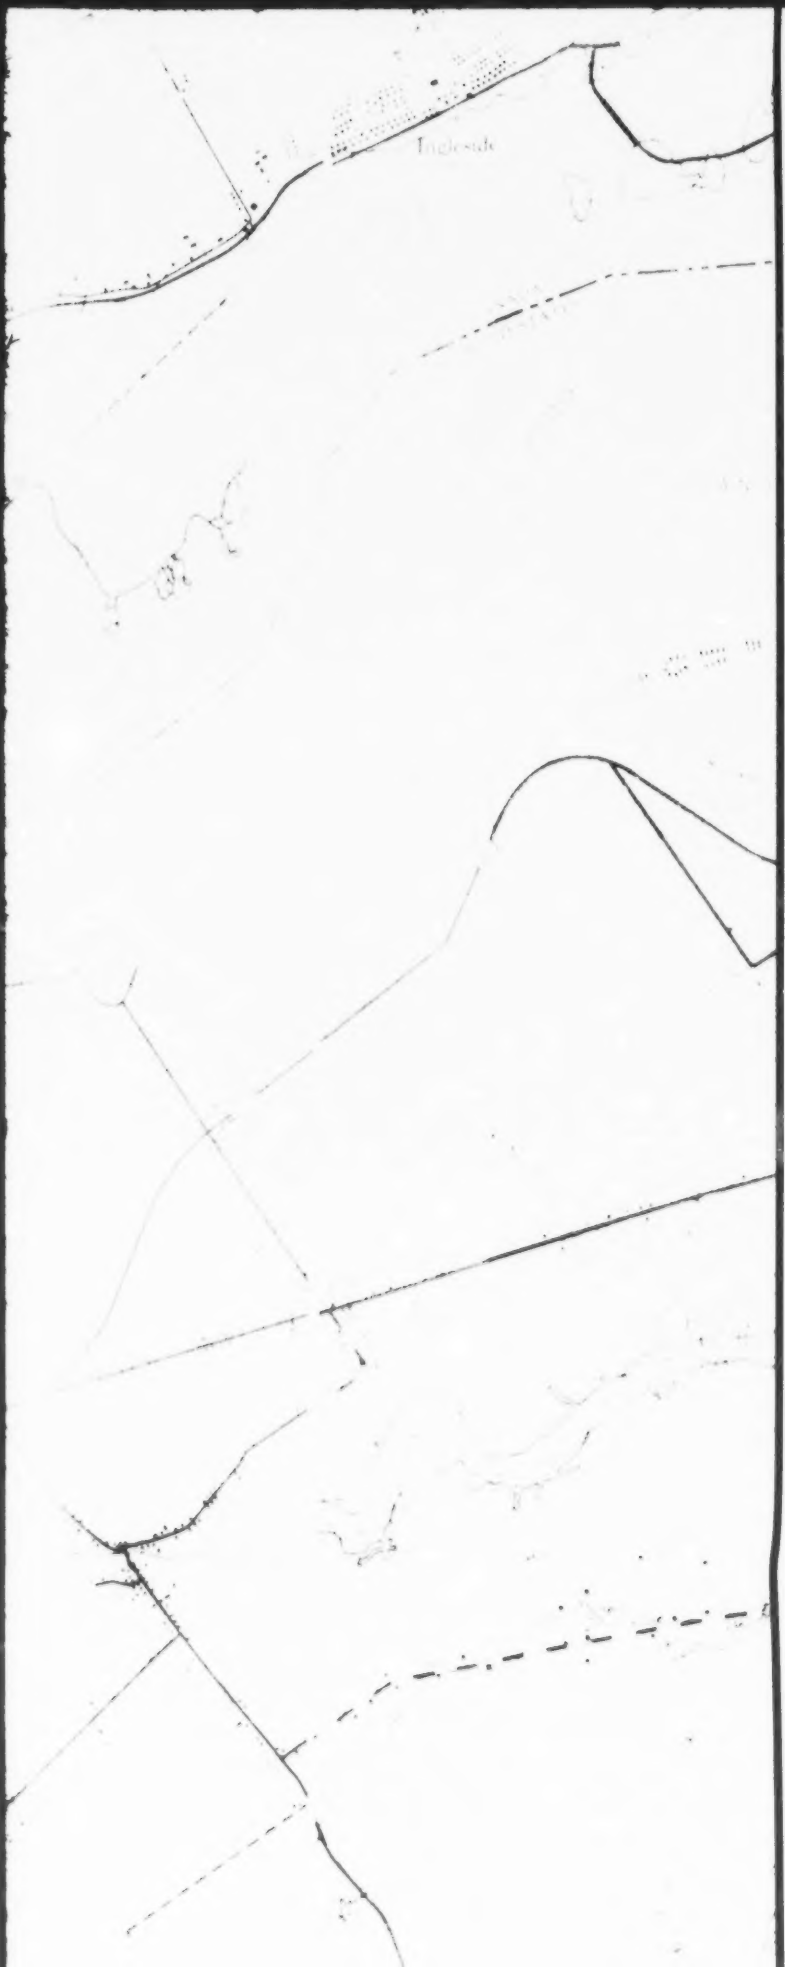

SYMBOLS

- △ Survey point
- 412△ Recorded data, see report
- Earth flow slide *
- Retrogressive rotational and retrogressive flowslides *
- ▲ Sheet slide
- ● Rotational slide
- Failing slope
- Internal erosion
- r Bedrock exposed *

* Not present on this map sheet

*Note: An explanation of the derivation of the Factor of Safety values is given in the text accompanying this map. Readings taken in the field are *time dependent* for the conditions of the slope at the time of recording the data.

The specific values are presented as a *guide* to the slope conditions and not as a basis for engineering design. Under all circumstances site specific studies and / or inspections should be carried out at all sites before any development is undertaken.

This map sheet partially overlies The Ottawa - Carlton region and portrays revised field data in selected areas.

SYMBOLS

- △ . . . Survey point.
- △^{284} . . Recorded data, see report.
- Earth flow slide.
- ♦ . . . Retrogressive rotational and retrogressive flowslides.
- ▲ . . . Sheet slide.
- ● . . . Rotational slide.
- ■ . . . Failing slope.
- □ . . . Internal erosion.
- *r* . . . Bedrock exposed.

SOURCES OF INFORMATION

Slope stability study by A.S. Poschmann, K.E. Klassen, M.A. Klugman, and D. Goodings, September 1978.
Supervision and revision by M.A. Klugman.
Field revisions by J.B. Turner, December 1981.
Map base assembly by Terra Surveys Limited from maps of the National Topographic System.
Aerial photograhy: Ontario Ministry of Natural Resources and National Air Photo Library, Ottawa.
Cartography by P.A. Ralph.

This map is published with the permission of J.R. Oatway, Regional Director, Eastern Region, Ontario, and E.G. Pye, Director, Ontario Geological Survey, Ministry of Natural Resources.

This project was funded by the South Nation River Conservation Authority, the Federal Department of Regional Economic Expansion, and the Ontario Ministry of Natural Resources.

Issued 1983

Parts of this publication may be quoted if credit is given. It is recommended that reference to this map be made in the following form:

Poschmann, A.S., Klassen, K.E., M.A. Klugman, and Goodings, D. 1983: Slope Stability Study of the South Nation River and Portions of the Ottawa River, Northern Sheet, Southern Ontario; Ontario Geological Survey, Map 2486, Geotechnical Series, scale 1:50 000. Compilation 1978, 1981.

Scale 1:50.000

Metres 1000 0 1 2 3 4 5 6 7 Kilometres

Chains 80 40 0 1 2 3 Miles

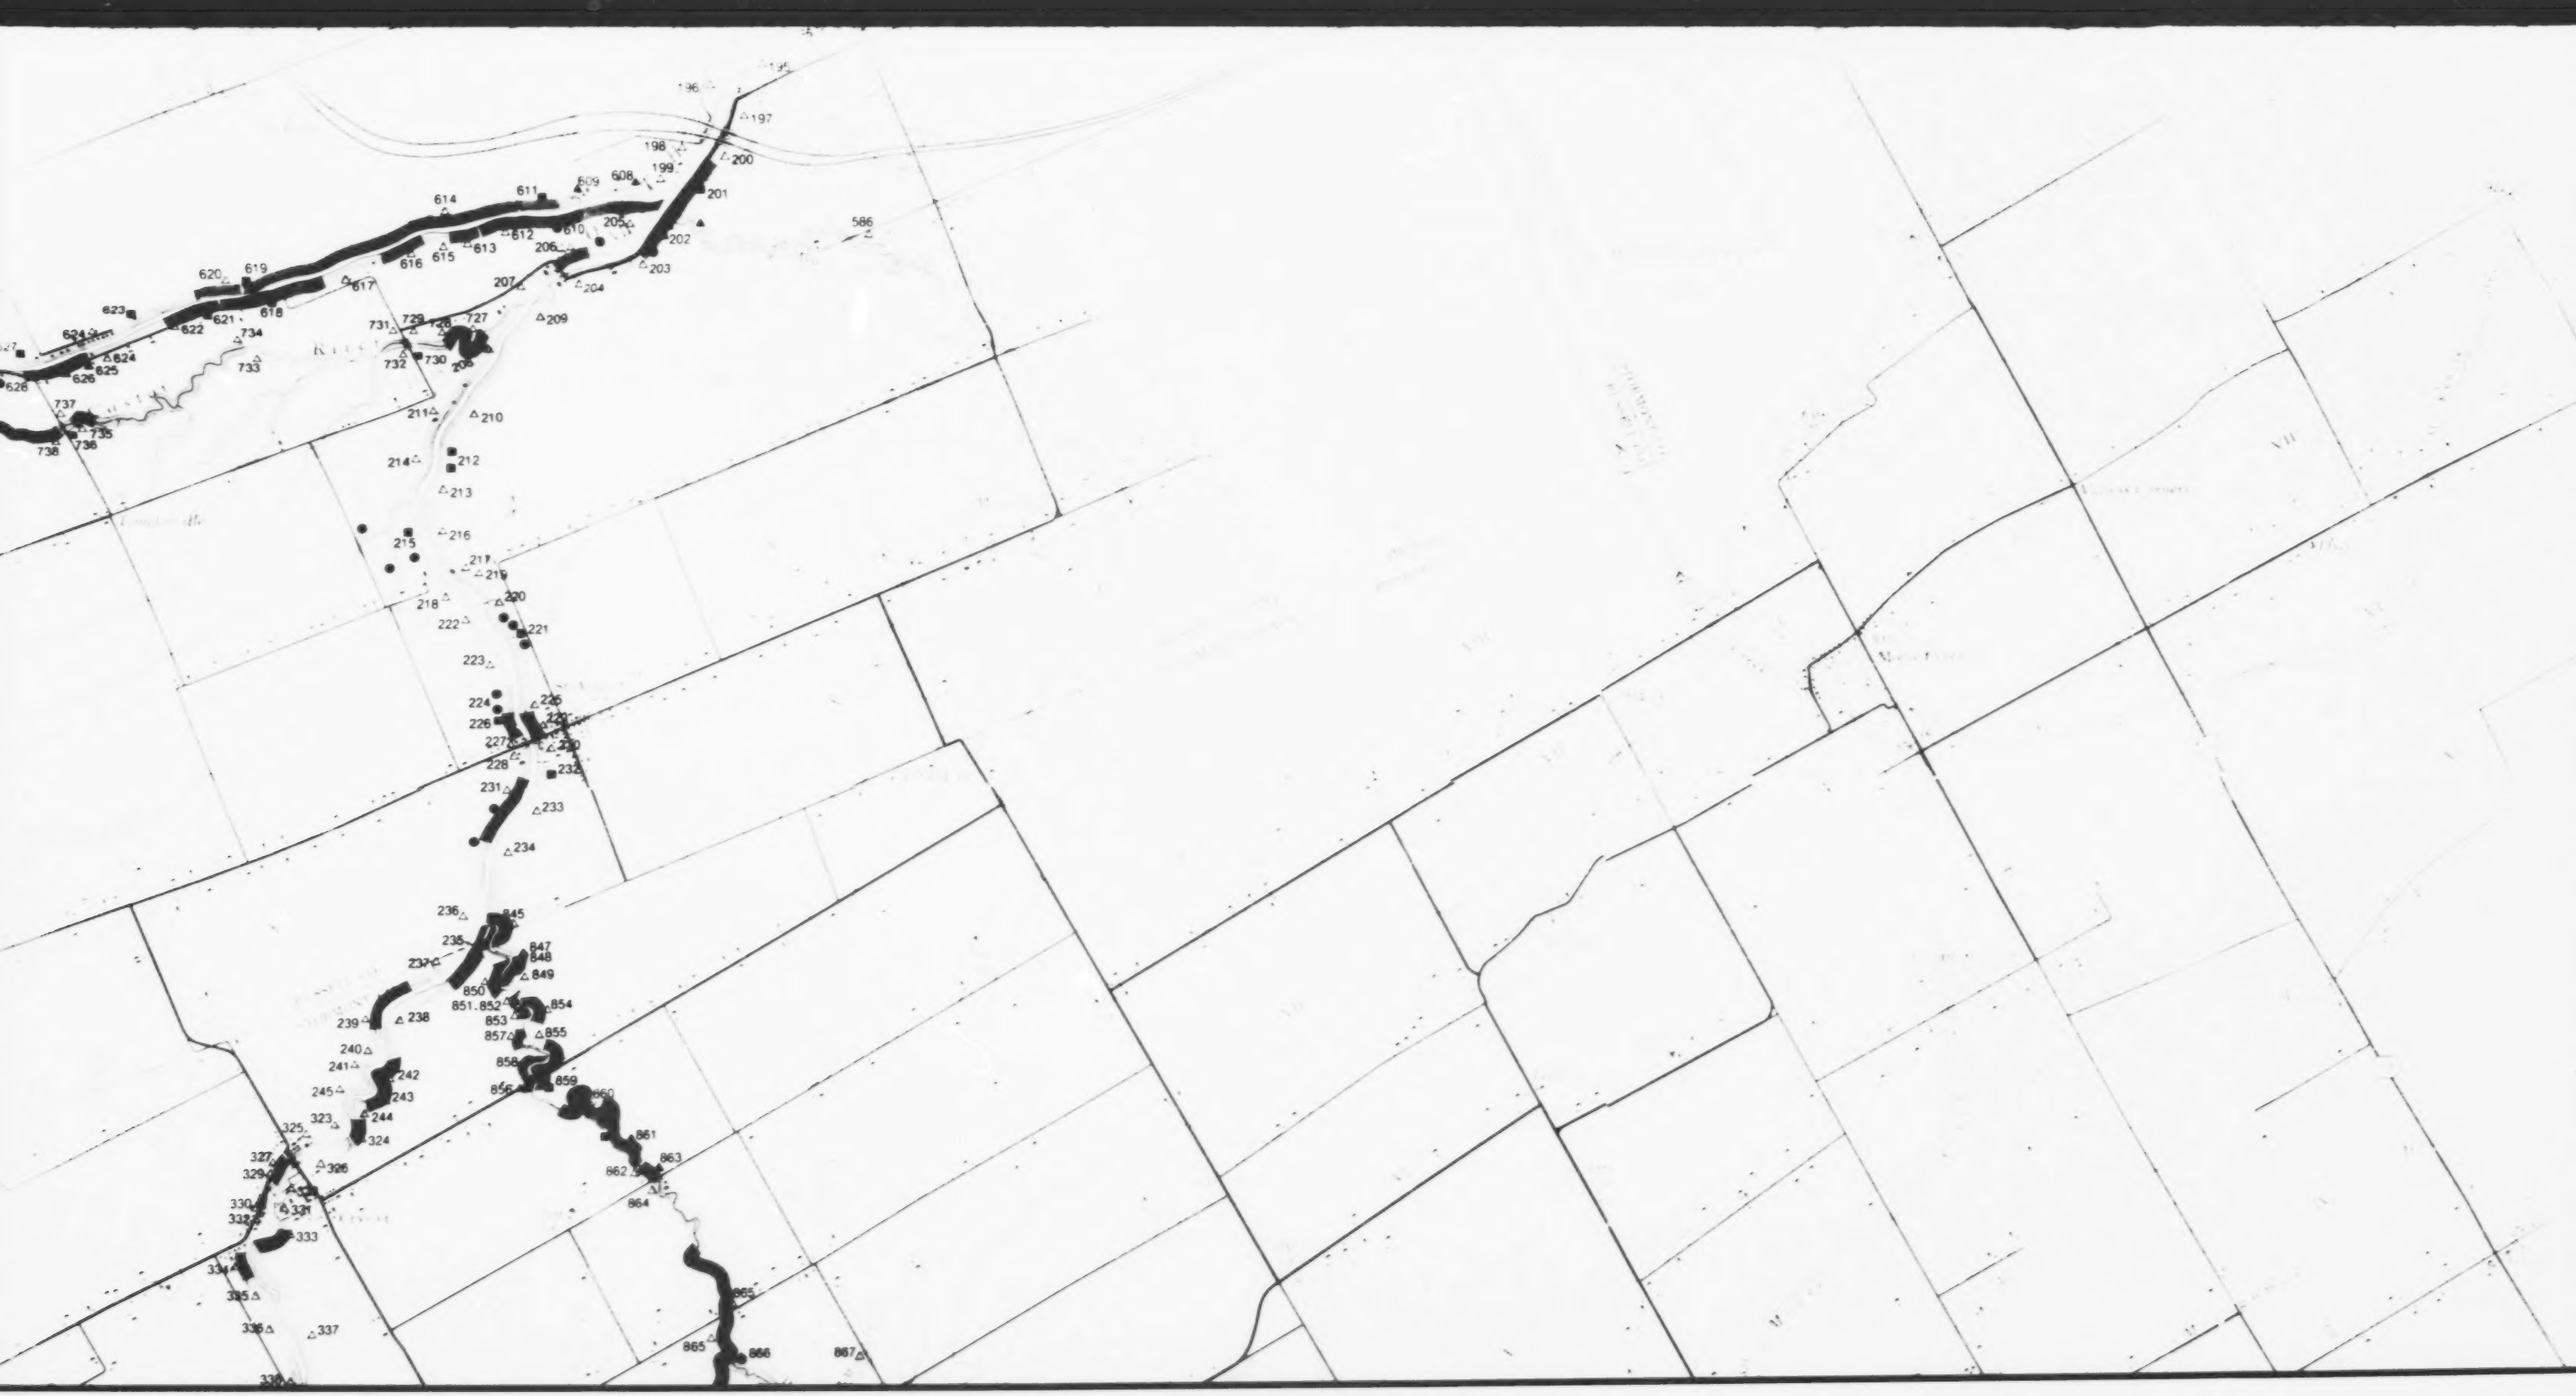
Kilometres
Miles

Maxville

XVII

45°13'N

74°45'N

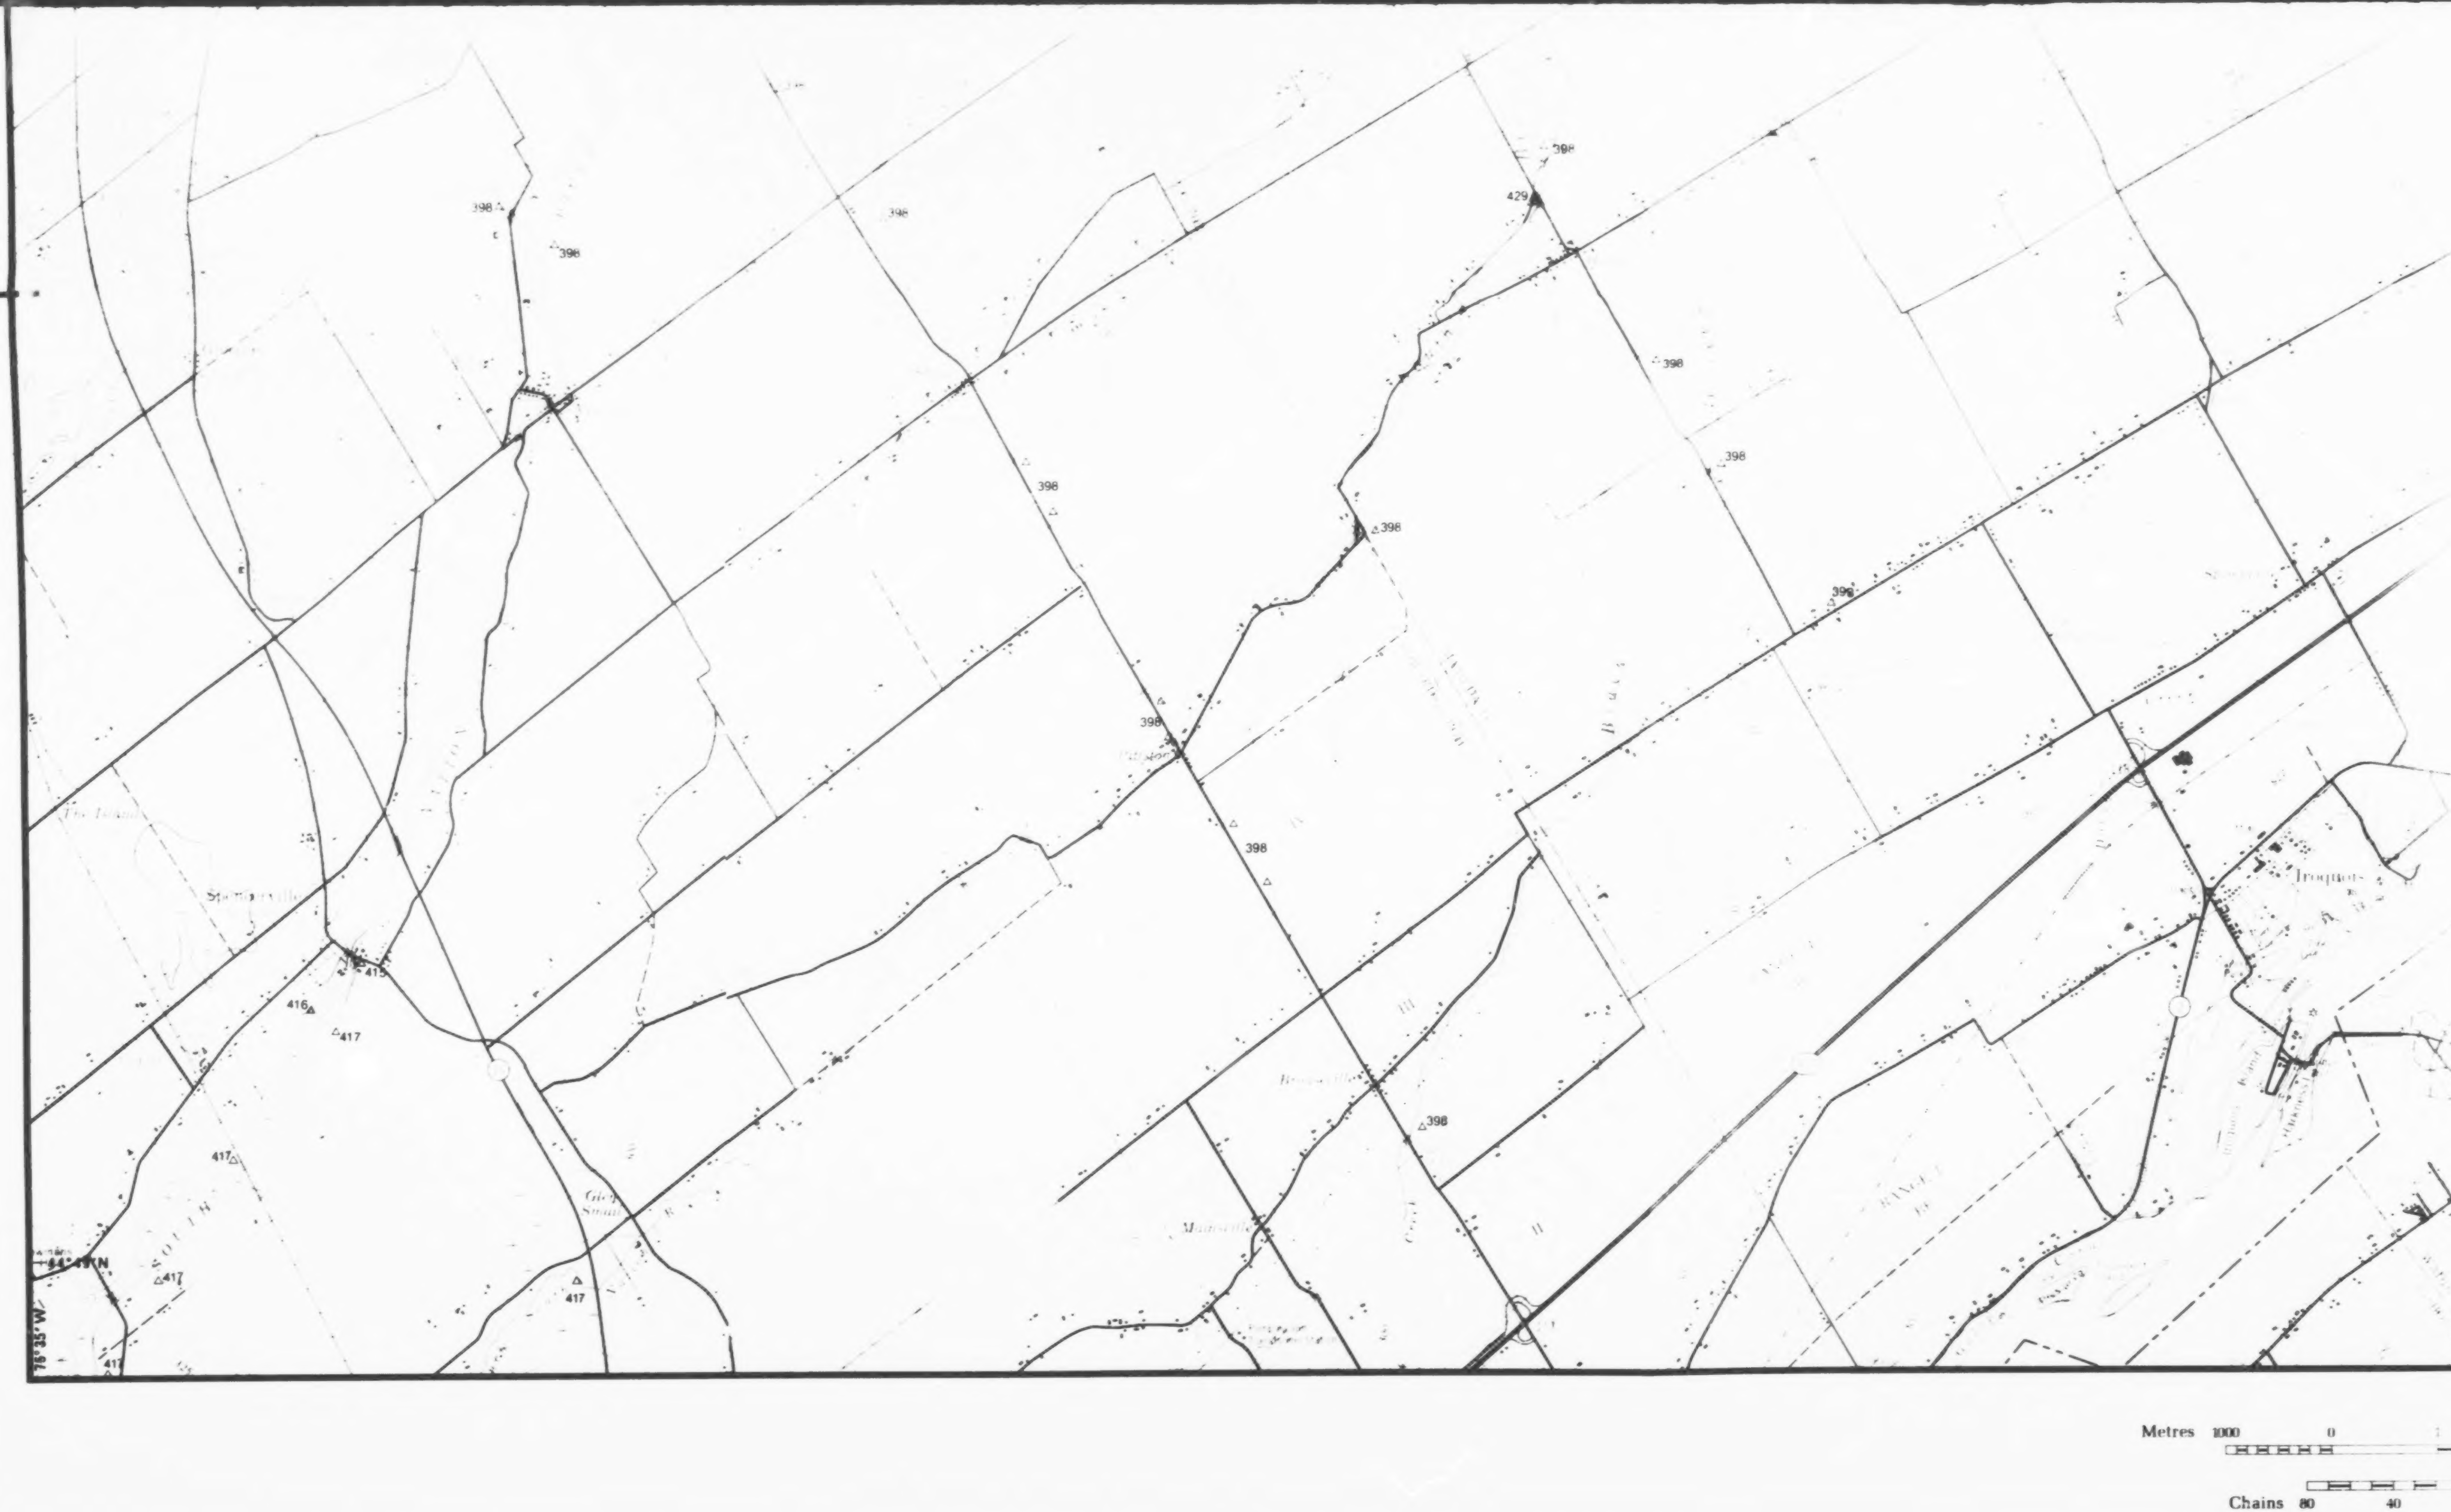

398
429
415
416
417
Iroquois
44°49'N
75°35'W
Metres 1000 0
Chains 80 40

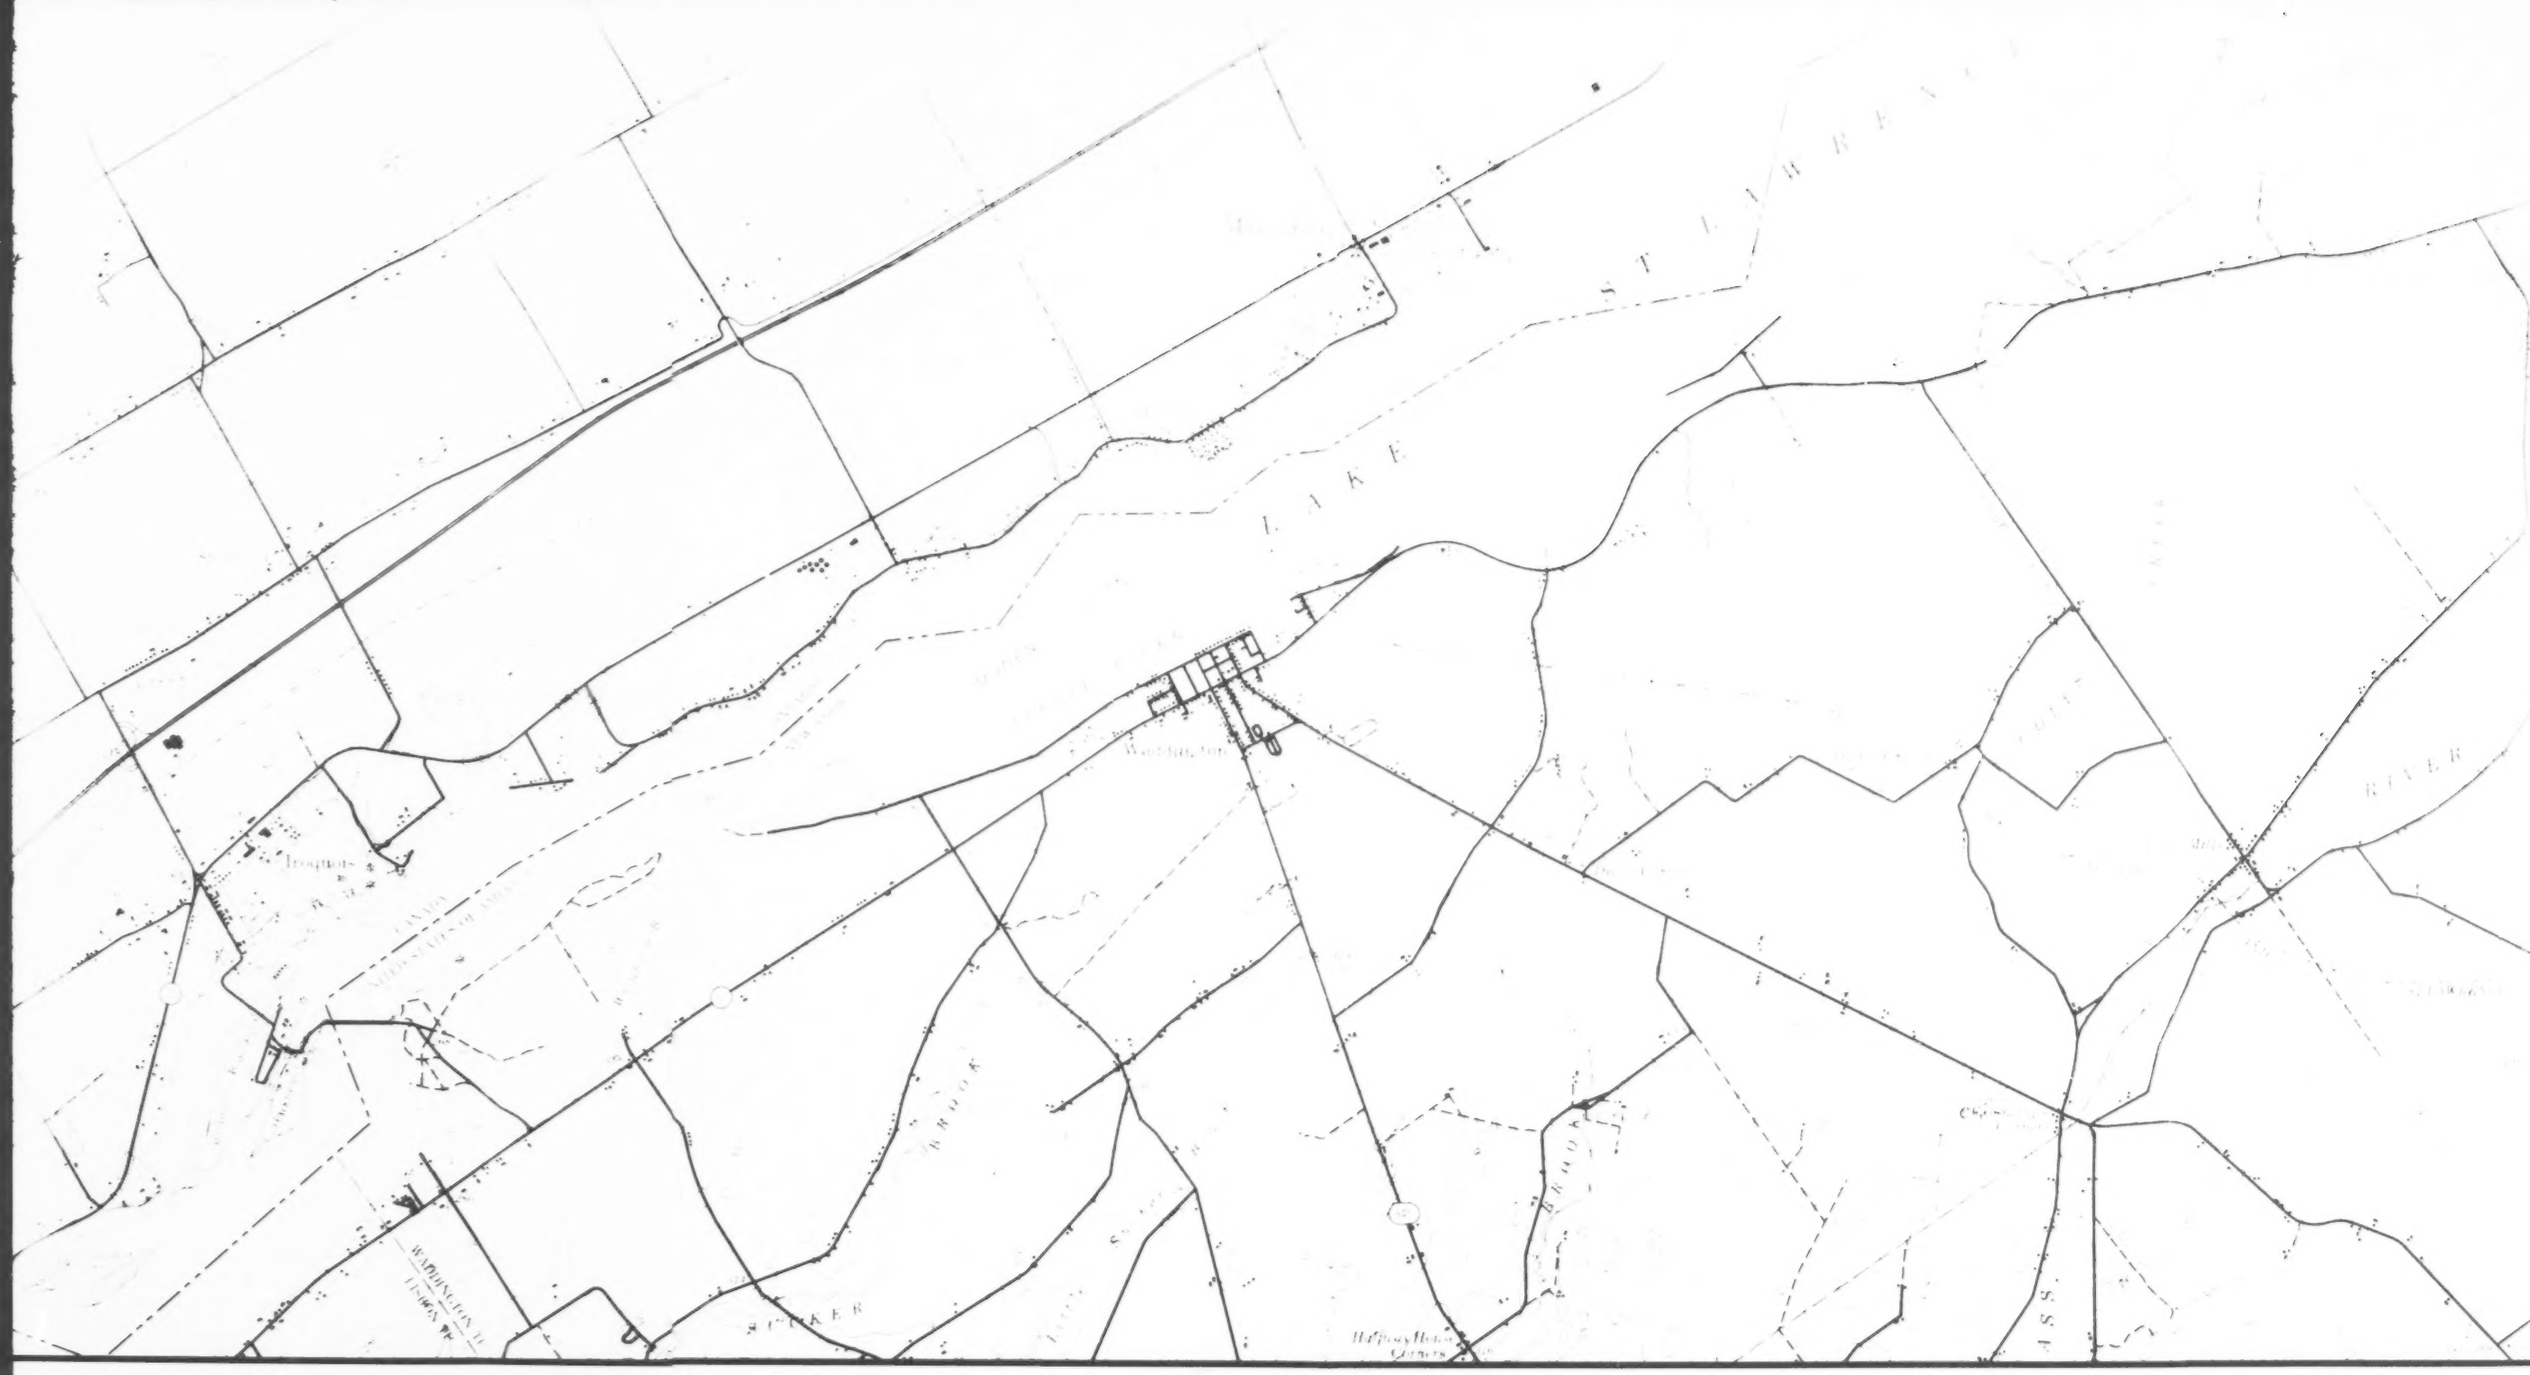
LAKE
ST
BROOK
RIVER
Scale 1:50,000
Metres 1000 0 1 2 3 4 5 6 7 Kilometres
Chains 80 40 0 1 2 3 Miles

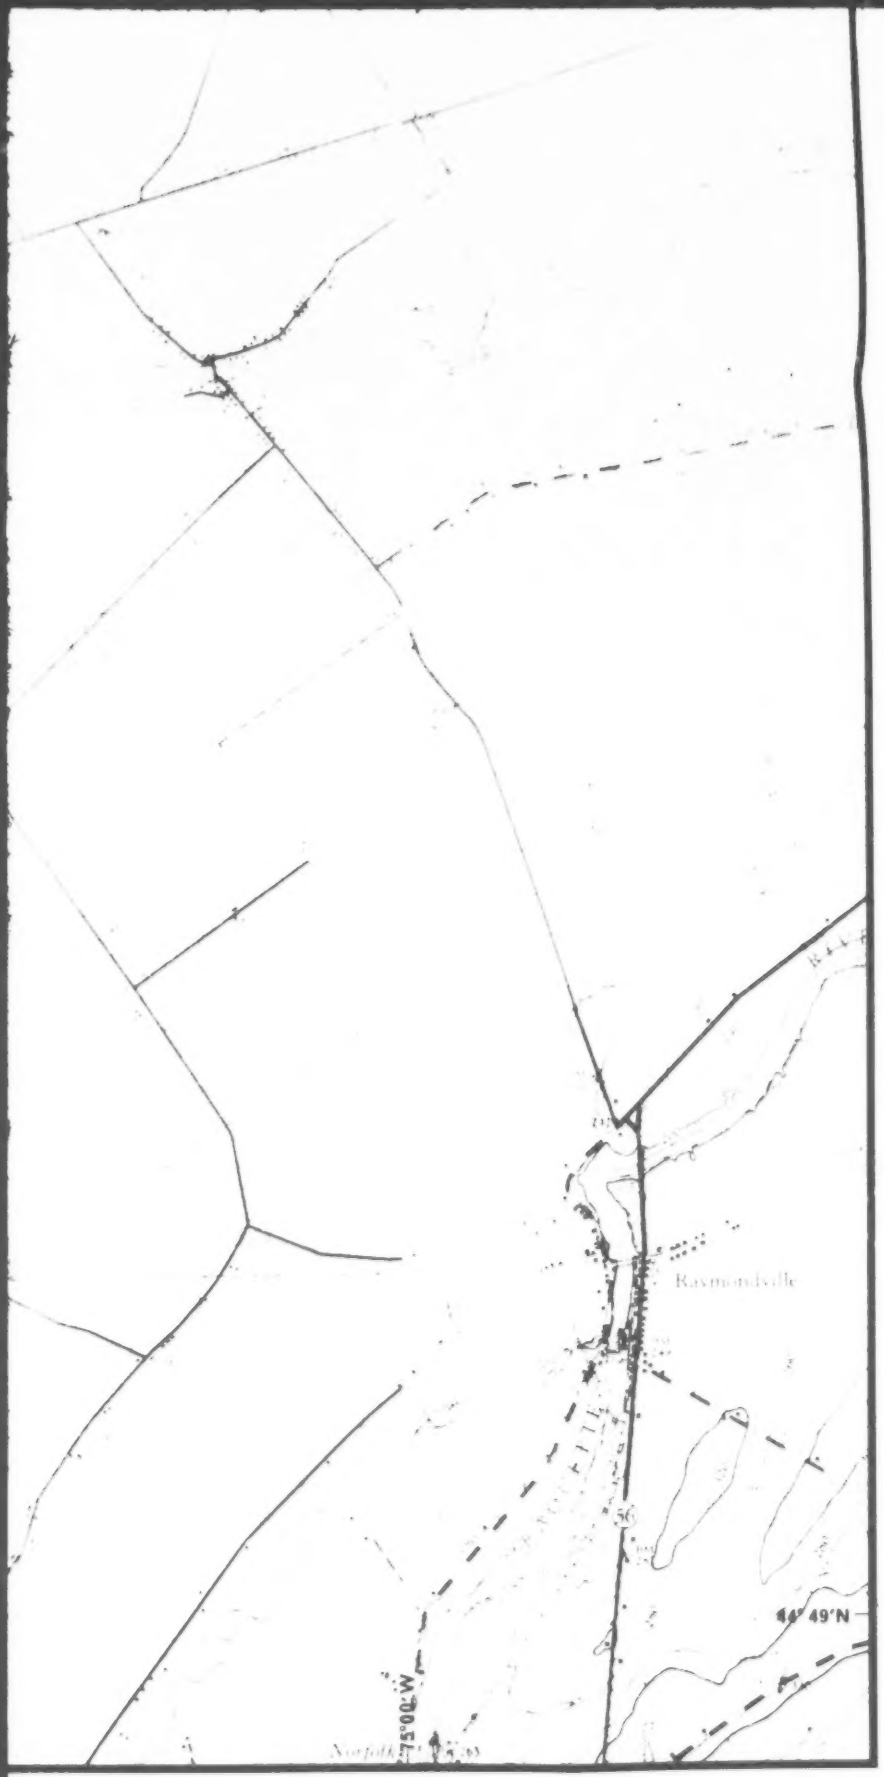

Not present on this map sheet

SOURCES OF INFORMATION

Slope stability study by A S Poschmann, K E Klassen, M A Klugman, and D Goodings, September 1978
Supervision and revision by M A Klugman
Field revisions by J B Turner, December 1981
Map base assembly by Terra Surveys Limited from maps of the National Topographic System
Aerial photography, Ontario Ministry of Natural Resources and National Air Photo Library, Ottawa
Cartography by P A Ralph

This map is published with the permission of J R Oatway, Regional Director, Eastern Region, Ontario, and E G Pye, Director, Ontario Geological Survey, Ministry of Natural Resources

This project was funded by the South Nation River Conservation Authority, the Federal Department of Regional Economic Expansion, and the Ontario Ministry of Natural Resources

Issued 1983

Parts of this publication may be quoted if credit is given. It is recommended that reference to this map be made in the following form:

Poschmann, A S., Klassen, K E., M A Klugman, and Goodings, D
1983 Slope Stability Study of the South Nation River and Portions of the Ottawa River, Southern Sheet, Southern Ontario; Ontario Geological Survey, Map 2487, Geotechnical Series, scale 1:50 000 Compilation 1978, 1981

POOR

QUALITY

ORIGINAL